

General Information

Date & Time: 27, Feb, 2026 16:05

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	138,144
Registration No.	DAO3112	Chassis No.	PA1B13F31K4082605
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



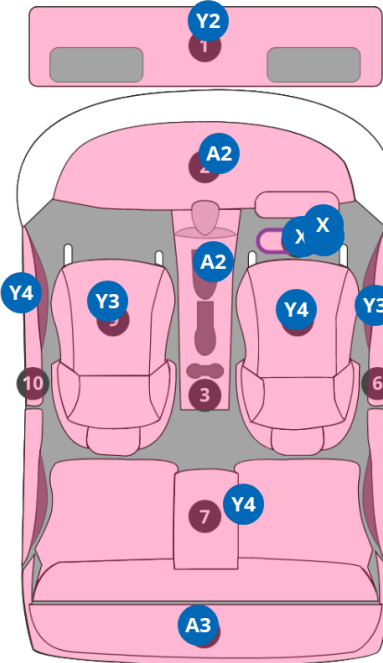
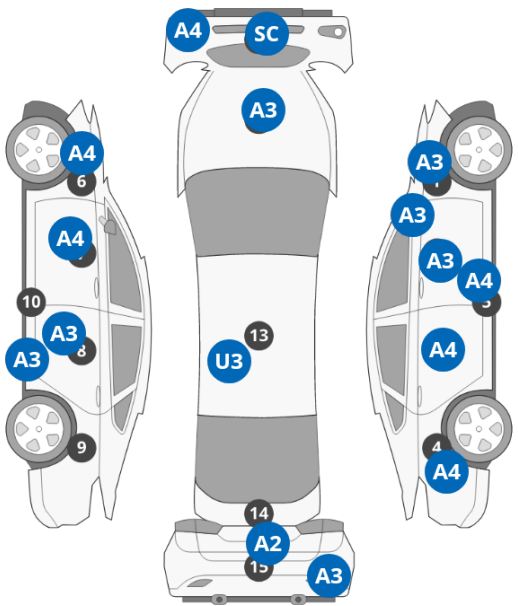
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	200.3	193	174	234
2	Boot Lid	119.3	119	118	121
3	Roof	97.5	110	98	89/94
4	Left Front Fender	155.0	158	143	164
5	Left Front Door	121.3	161	100	103
6	Center Panel Left				
7	Left Rear Door	106.6	113	107	100
8	Left Back Panel	115.0	129	106	110
9	Right Front Fender	134.3	137	137	129
10	Right Front Door	140.0	110	123	187
11	Center Panel Right				
12	Right Rear Door	182.0	182	199	165
13	Right Back Panel	317.3	125	174	653

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Medium / Member (Bolted) - Rust, Corrosion - Yes
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Condition of Welding ? - Yes	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/cheek lightissue/plate light issue/park light issue/No warranty booklet/with reverse camera/with jack No tools/front and back floor mats missing/coin pocket issue/rear seat issue/interior dirty/ cross member support traces of welding.