

General Information

Date & Time: 05, Feb, 2025 10:54

Make	Toyota	Model	Vios
YOM	2023	Mileage	36,958
Registration No.	NHJ4254	Chassis No.	PA1B18F34P4215250
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



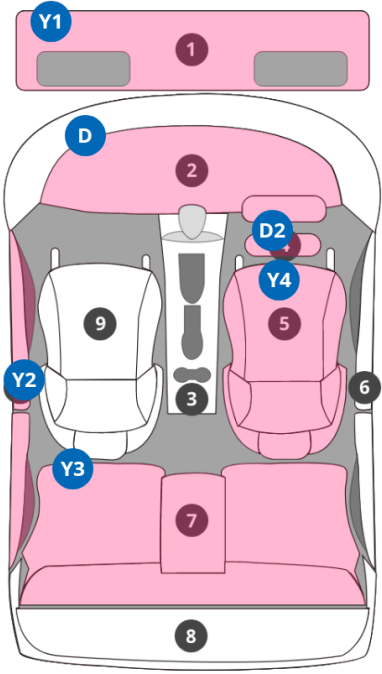
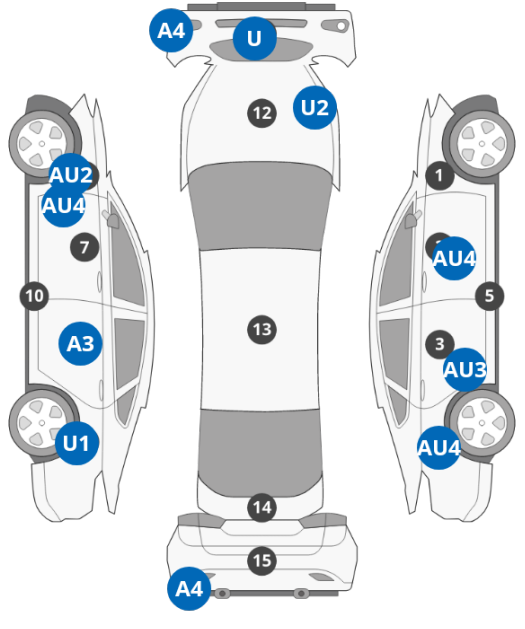
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	109	102	117
2	Boot Lid	99.2	96	97	105
3	Roof	92.8	93	96	87/95
4	Left Front Fender	96.1	100	102	87
5	Left Front Door	94.6	94	92	98
6	Center Panel Left				
7	Left Rear Door	95.4	98	96	93
8	Left Back Panel	111.6	124	102	109
9	Right Front Fender	92.1	90	94	93
10	Right Front Door	91.3	94	90	90
11	Center Panel Right				
12	Right Rear Door	94.8	88	97	100
13	Right Back Panel	102.0	96	97	113

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack and no tools, with spare tire, with LTO plate, both front tire worn, adhesive mark on front windshield upper right