

General Information

Date & Time: 03, Mar, 2026 10:14

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,792
Registration No.	NHM4111	Chassis No.	PA1B18F36P4232028
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



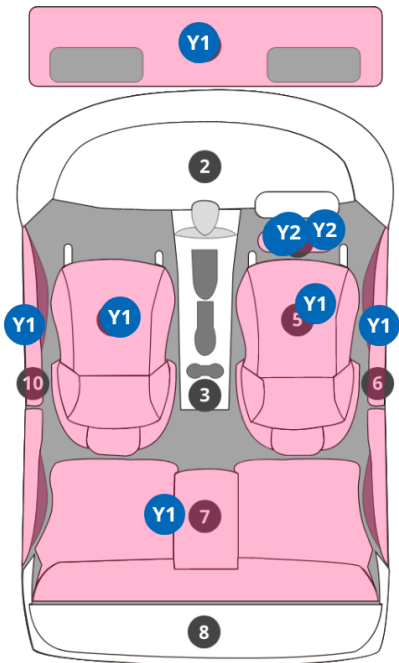
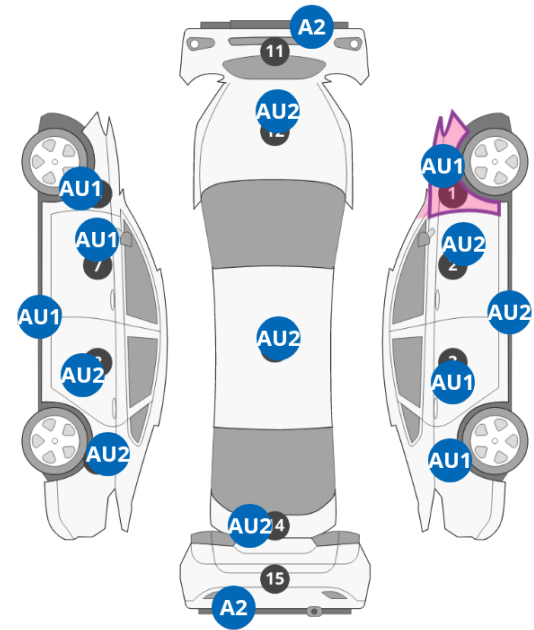
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.3	118	106	122
2	Boot Lid	119.0	113	112	132
3	Roof	103.5	111	108	93/102
4	Left Front Fender	102.1	107	96	104
5	Left Front Door	108.6	109	111	106
6	Center Panel Left				
7	Left Rear Door	106.3	109	102	108
8	Left Back Panel	118.6	119	130	107
9	Right Front Fender	105.6	103	105	109
10	Right Front Door	132.6	128	143	127
11	Center Panel Right				
12	Right Rear Door	111.3	118	108	108
13	Right Back Panel	109.3	106	108	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with warranty booklet, scratches on taillight and headlight, no spare key, no reverse camera.</p>