

General Information

Date & Time: 02, Mar, 2026 14:01

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	22,277
Registration No.	NHQ3027	Chassis No.	PA2JA8EMXP0135332
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



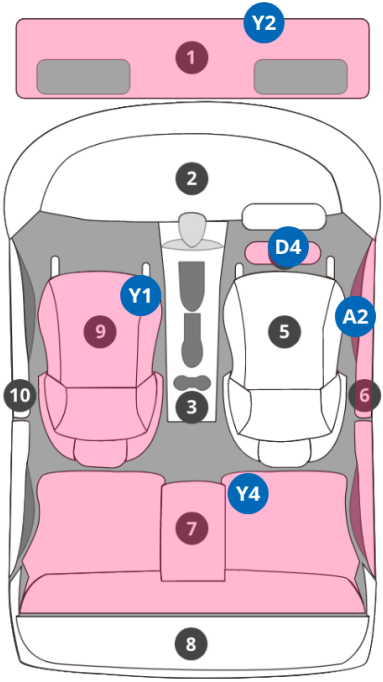
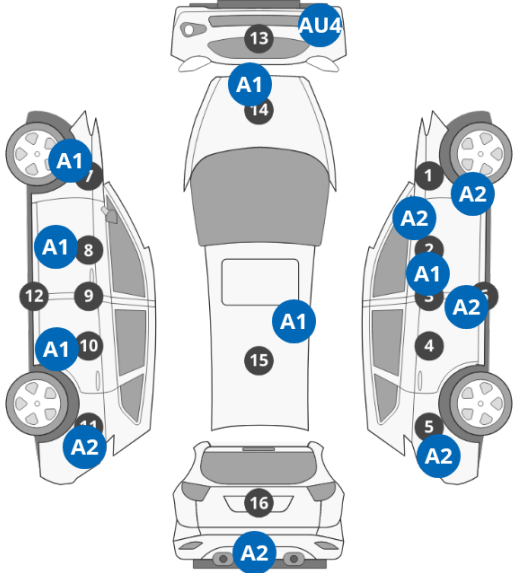
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	121	120	117
2	Boot Lid	108.3	105	115	105
3	Roof	99.8	93	95	111/100
4	Left Front Fender	97.8	89	103	102
5	Left Front Door	101.0	98	101	104
6	Center Panel Left				
7	Left Rear Door	109.0	115	111	101
8	Left Back Panel	113.0	113	119	107
9	Right Front Fender	98.7	100	106	90
10	Right Front Door	102.3	100	101	106
11	Center Panel Right				
12	Right Rear Door	101.3	94	106	104
13	Right Back Panel	106.6	105	105	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Large / (R) Front Trim - Cut, Crack - Small / Rear Seat - Grime - Large / (L) Front Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, with jack and tools, with spare tire, no warranty booklet, scratches on taillight</p>