

General Information

Date & Time: 05, Feb, 2025 10:07

Make	Toyota	Model	Vios
YOM	2023	Mileage	24,112
Registration No.	BAF3541	Chassis No.	PA1B18F32P4219944
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



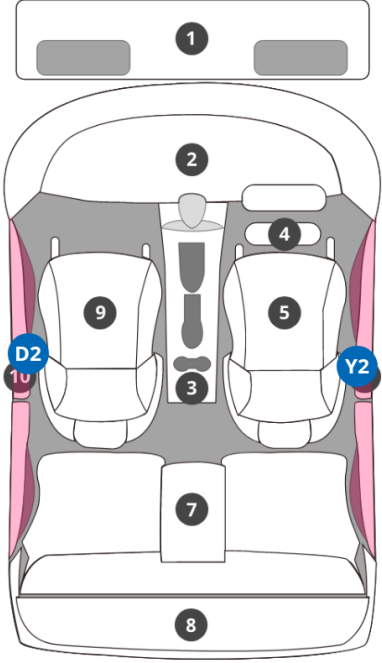
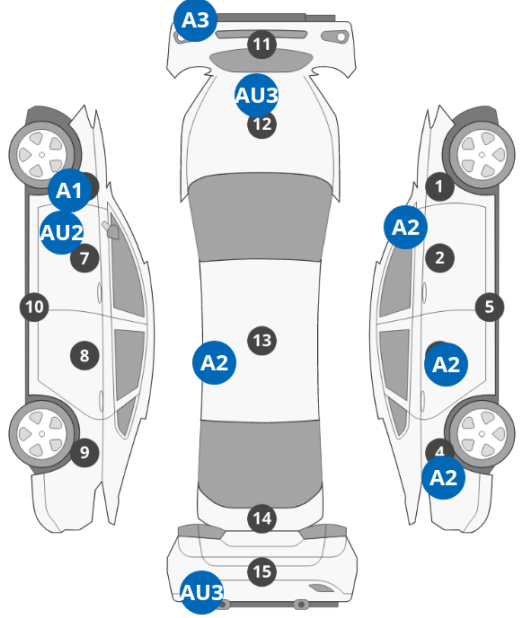
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.1	107	107	98
2	Boot Lid	107.3	100	111	111
3	Roof	96.4	99	97	91/98
4	Left Front Fender	97.9	102	96	96
5	Left Front Door	96.6	98	93	100
6	Center Panel Left				
7	Left Rear Door	98.0	100	99	95
8	Left Back Panel	103.4	109	102	99
9	Right Front Fender	101.0	100	103	100
10	Right Front Door	91.9	98	87	90
11	Center Panel Right				
12	Right Rear Door	95.8	94	96	98
13	Right Back Panel	98.5	95	102	99

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Crinkle - Small	Remarks Bonnet, Headlight - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof Spoiler, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with sparetire, no jack, no tools, with LTO plate, No reverse camera