

General Information

Date & Time: 04, Mar, 2026 15:30

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	4,379
Registration No.	NKQ5786	Chassis No.	MHFAA1BY0S0043173
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



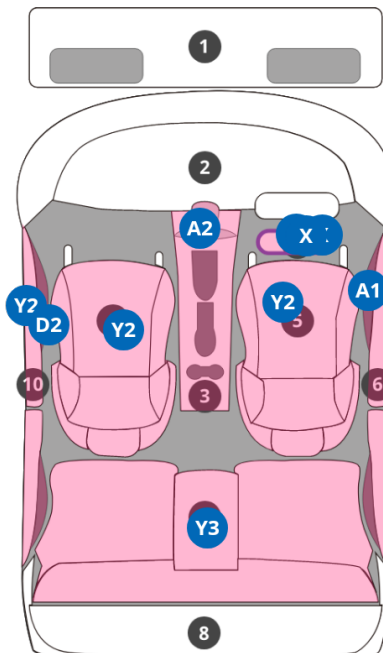
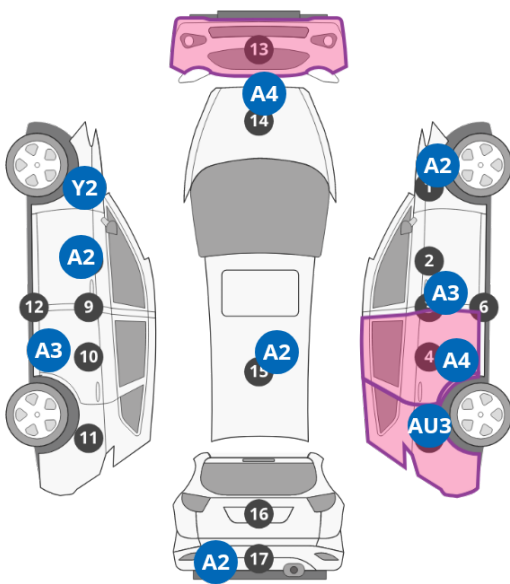
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.1	106	90	101
2	Boot Lid	112.3	103	107	127
3	Roof	122.5	132	134	111/113
4	Left Front Fender	127.3	149	121	112
5	Left Front Door	122.6	111	124	133
6	Center Panel Left				
7	Left Rear Door	119.0	126	109	122
8	Left Back Panel	132.6	132	126	140
9	Right Front Fender	113.3	121	113	106
10	Right Front Door	119.6	127	118	114
11	Center Panel Right				
12	Right Rear Door	219.0	365	141	151
13	Right Back Panel	255.6	170	190	407

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Cut, Crack - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Rear Trim - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Mat Other - Missing - Yes</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Crack, Gap - Small / Bonnet, Headlight - Scratch - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate, no warranty and manual booklet, with reverse camera, with spare tire, no spare key, no wiper blades, no tools and jack, scratches on taillight and headlight</p>