

## General Information

Date & Time: 27, Feb, 2026 15:52

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	66,410
<b>Registration No.</b>	CCA8164	<b>Chassis No.</b>	PA1B18F33R4257539
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



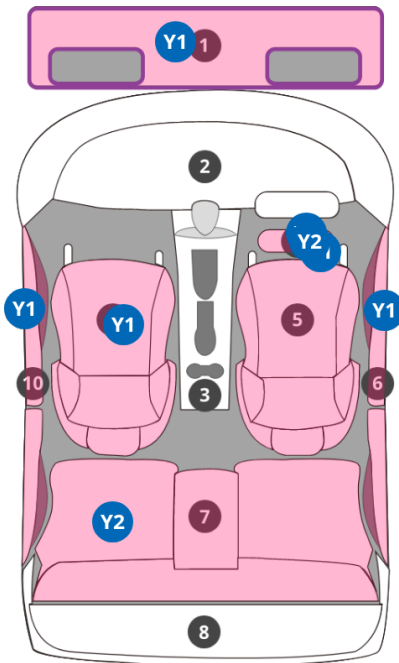
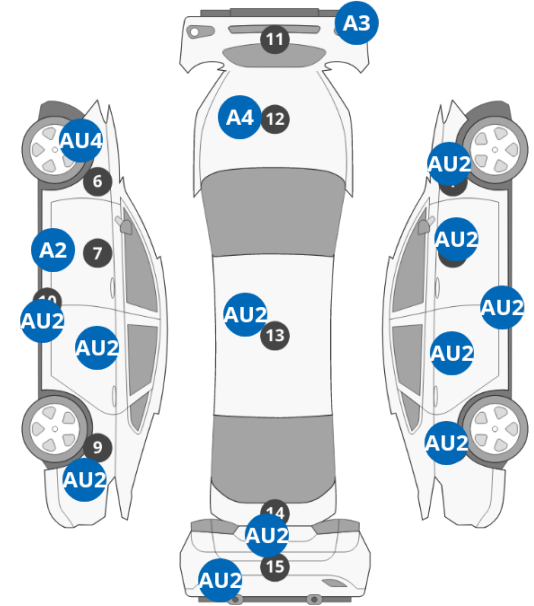
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	131	114	127
2	Boot Lid	121.6	118	114	133
3	Roof	113.2	121	105	115/112
4	Left Front Fender	108.6	104	107	115
5	Left Front Door	116.6	112	117	121
6	Center Panel Left				
7	Left Rear Door	127.6	131	139	113
8	Left Back Panel	132.3	162	120	115
9	Right Front Fender	117.6	121	116	116
10	Right Front Door	168.6	175	160	171
11	Center Panel Right				
12	Right Rear Door	175.6	182	168	177
13	Right Back Panel	114.3	115	111	117

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / Room Lamp - Missing - Yes</p>	<p><b>Remarks</b> (R) Rear Door - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate ,with manual booklet, with reverse camera, with jack, with spare tire, scratches on taillight and headlight, no manual and warranty booklet, no tools,</p>