

General Information

Date & Time: 10, Mar, 2026 13:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	7,406
Registration No.	GBJ1865	Chassis No.	PA1B18F36R4279180
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



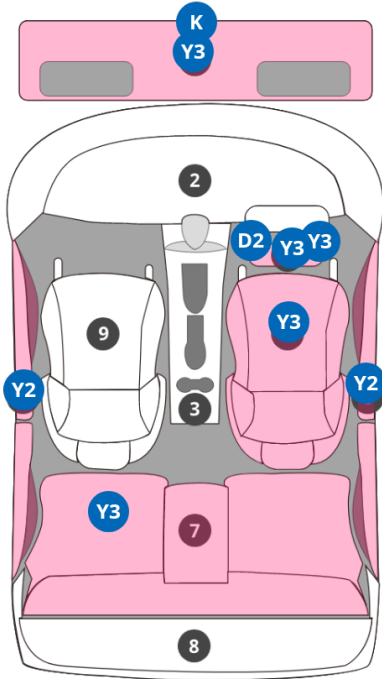
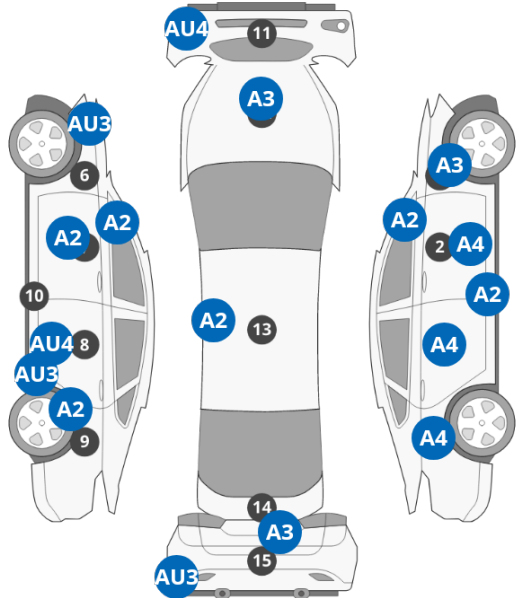
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	122	116	119
2	Boot Lid	113.3	112	106	122
3	Roof	106.9	109	116	98/105
4	Left Front Fender	108.3	113	108	104
5	Left Front Door	107.0	104	106	111
6	Center Panel Left				
7	Left Rear Door	122.0	131	123	112
8	Left Back Panel	121.3	136	115	113
9	Right Front Fender	117.6	115	119	119
10	Right Front Door	113.3	121	108	111
11	Center Panel Right				
12	Right Rear Door	118.3	109	110	136
13	Right Back Panel	116.3	117	119	113

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
Gap at front bumper and front right fender. With warranty booklet, spare tire and jack. Without tools and seat cover. 3 keys. With LTO plate.