

General Information

Date & Time: 10, Mar, 2026 14:55

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	13,093
Registration No.	GBJ8341	Chassis No.	MHKAA1BC4SJ036243
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



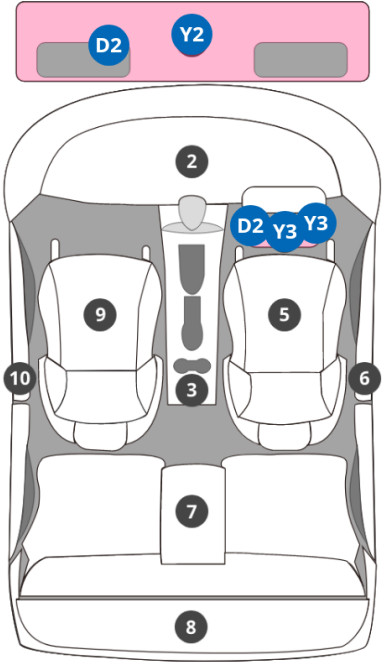
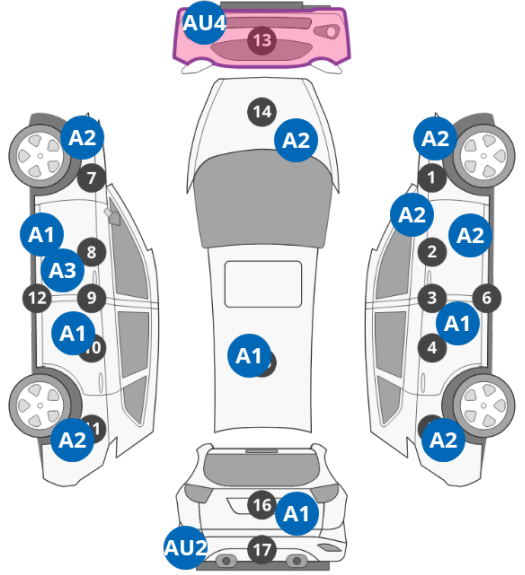
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	124	129	129
2	Boot Lid	108.6	105	113	108
3	Roof	104.4	109	99	112/98
4	Left Front Fender	106.0	103	110	105
5	Left Front Door	113.3	114	110	116
6	Center Panel Left				
7	Left Rear Door	108.0	110	112	102
8	Left Back Panel	107.0	111	109	101
9	Right Front Fender	102.9	100	103	106
10	Right Front Door	107.3	107	108	107
11	Center Panel Right				
12	Right Rear Door	118.0	122	114	118
13	Right Back Panel	103.3	104	102	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Medium / Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Small / Mat Other - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes

Inspector Notes

With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate.