

General Information

Date & Time: 02, Mar, 2026 12:51

Make	Mitsubishi	Model	Mirage
YOM	2020	Odo Meter Reading	34,000
Registration No.	NGT5659	Chassis No.	PAEA13RXLLA012357
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



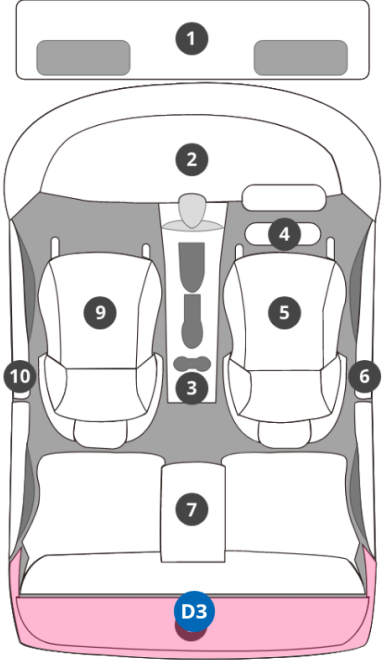
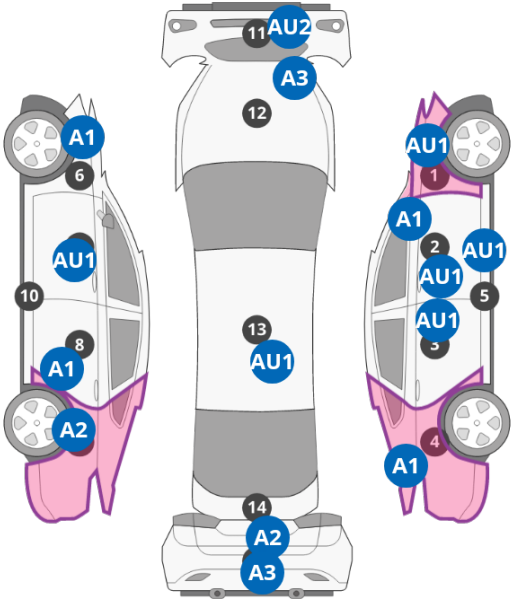
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	139	106	106
2	Boot Lid	98.5	92	104	100
3	Roof	104.6	97	100	128/93
4	Left Front Fender	102.3	106	105	96
5	Left Front Door	94.5	96	95	92
6	Center Panel Left				
7	Left Rear Door	117.3	98	135	119
8	Left Back Panel	151.6	156	155	144
9	Right Front Fender	121.3	100	139	125
10	Right Front Door	102.2	103	104	100
11	Center Panel Right				
12	Right Rear Door	149.3	150	136	162
13	Right Back Panel	236.0	183	177	348

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Trunk Room - Loose, Deformed - Medium	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes	
With Lto plate, with jack, 1key, no warranty booklet, no spare tire and tools, scratches on headlights and taillights, cover under trunk missing	