

General Information

Date & Time: 03, Mar, 2026 15:46

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	22,615
Registration No.	DBF9433	Chassis No.	MHKAA1BC1RJ015697
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



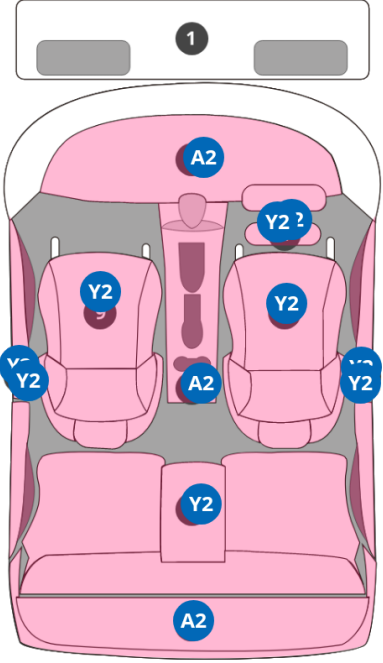
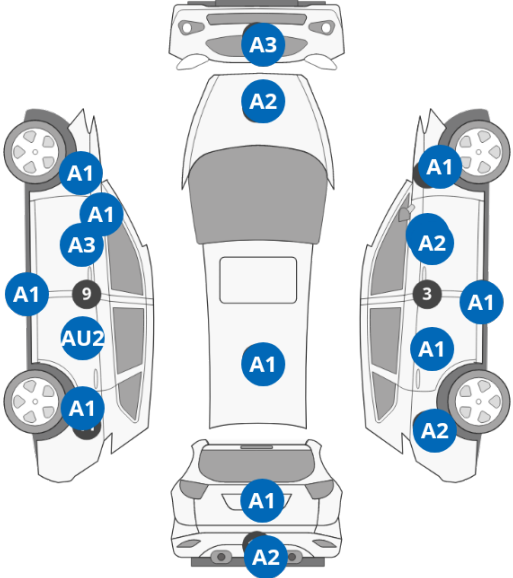
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.6	127	124	132
2	Boot Lid	101.3	93	108	103
3	Roof	101.7	100	99	104/104
4	Left Front Fender	110.0	122	113	95
5	Left Front Door	110.3	105	110	116
6	Center Panel Left				
7	Left Rear Door	101.3	110	105	89
8	Left Back Panel	106.3	104	119	96
9	Right Front Fender	110.3	117	113	101
10	Right Front Door	120.6	114	123	125
11	Center Panel Right				
12	Right Rear Door	115.6	110	121	116
13	Right Back Panel	100.7	108	97	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small	Remarks Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with spare tire/with jack and incomplete tools/No spare key/with reverse camera/with seat cover