

General Information

Date & Time: 03, Mar, 2026 13:02

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,117
Registration No.	DBO9684	Chassis No.	PA1B18F36R4259012
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



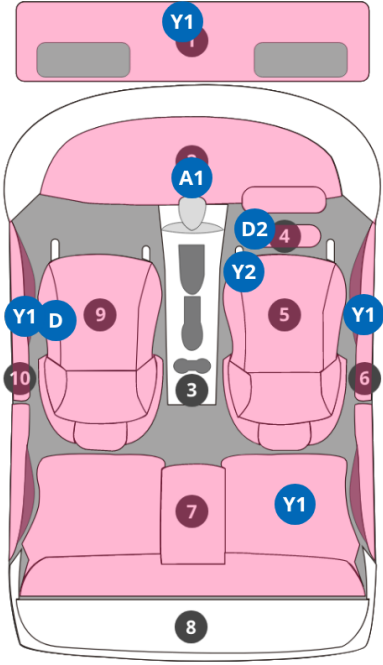
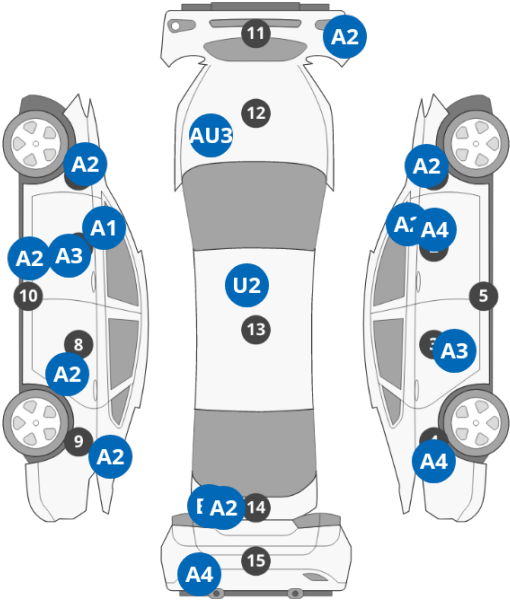
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	111	122	118
2	Boot Lid	116.0	109	118	121
3	Roof	97.5	104	106	87/94
4	Left Front Fender	103.0	104	103	102
5	Left Front Door	108.0	108	114	102
6	Center Panel Left				
7	Left Rear Door	98.5	101	100	95
8	Left Back Panel	120.3	129	128	104
9	Right Front Fender	106.1	109	111	98
10	Right Front Door	102.6	106	103	99
11	Center Panel Right				
12	Right Rear Door	107.6	118	100	105
13	Right Back Panel	109.0	106	105	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Modified - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratched and cracked tail light</p>