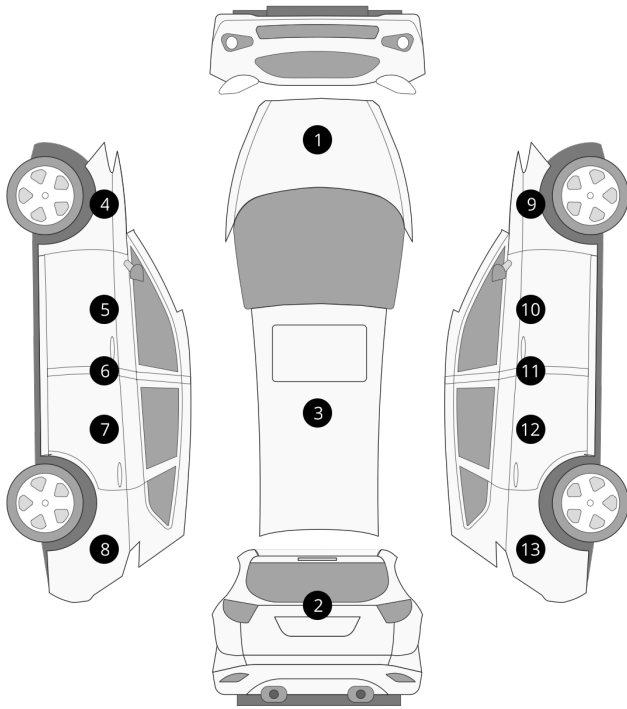


General Information

Date & Time: 03, Mar, 2026 13:02

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	41,206
Registration No.	DBR4397	Chassis No.	MHFAA1BY1R0030649
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



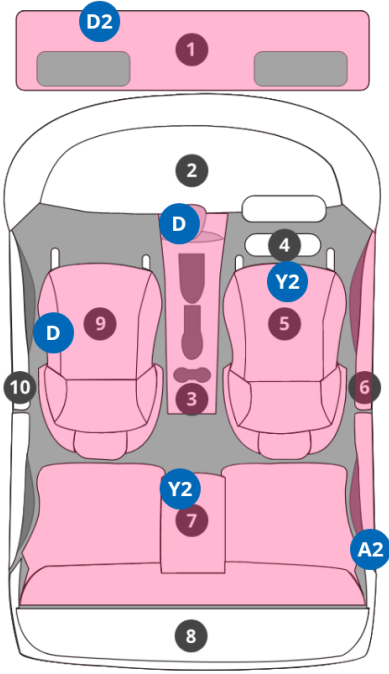
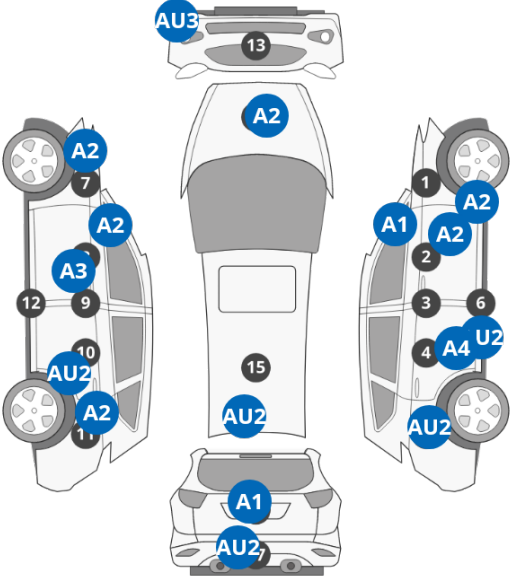
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	120	120	118
2	Boot Lid	94.0	89	105	89
3	Roof	117.5	124	125	107/114
4	Left Front Fender	103.3	103	105	102
5	Left Front Door	121.3	119	121	124
6	Center Panel Left				
7	Left Rear Door	113.6	117	109	115
8	Left Back Panel	128.0	125	115	144
9	Right Front Fender	105.9	110	112	96
10	Right Front Door	117.6	123	117	113
11	Center Panel Right				
12	Right Rear Door	127.0	119	110	152
13	Right Back Panel	124.3	130	127	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Trim Other - Cut, Crack - Small / Ceiling - Crinkle - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, air-conditioning system issue