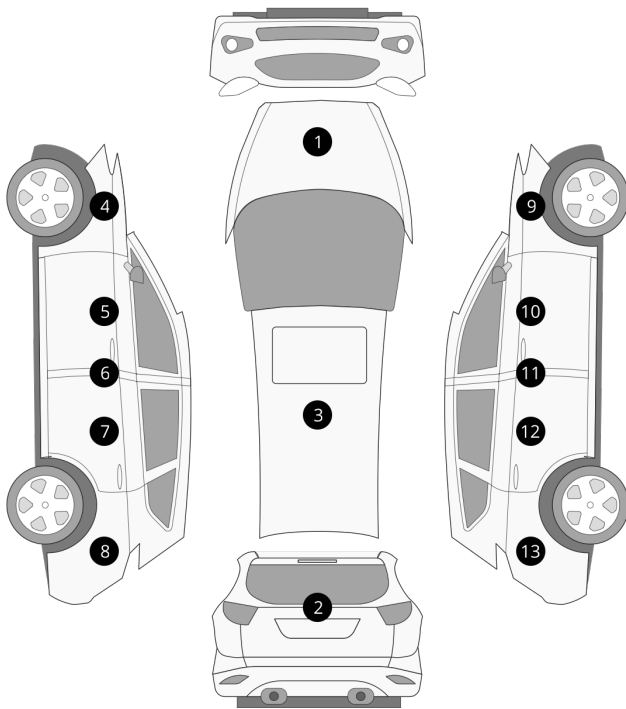


General Information

Date & Time: 04, Mar, 2026 15:29

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	62,257
Registration No.	NFA4623	Chassis No.	JTFJT02P9P0016349
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



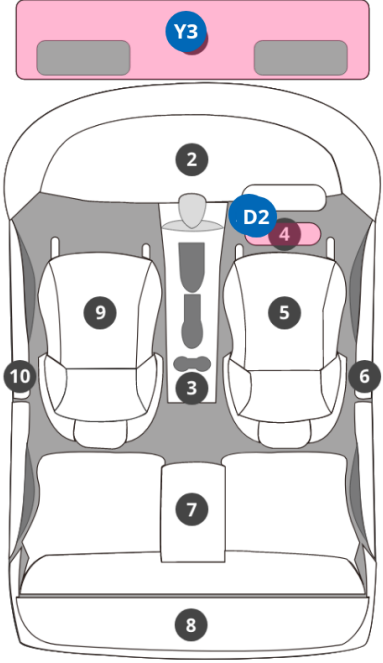
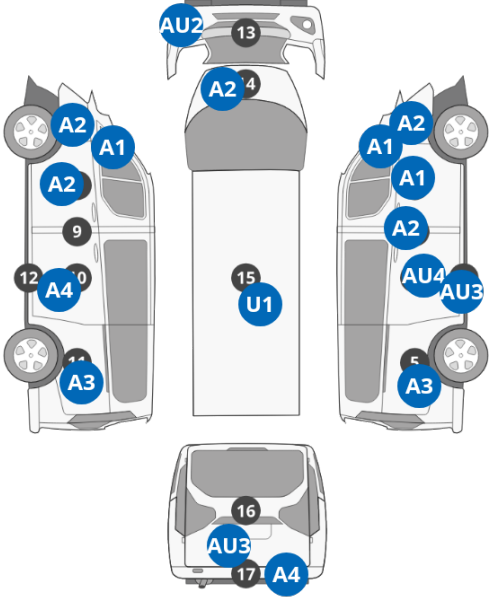
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.5	86	92	88
2	Boot Lid	95.8	95	104	89
3	Roof	77.1	86	87	63/72
4	Left Front Fender	88.7	92	85	89
5	Left Front Door	93.5	87	105	88
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	86.1	89	82	87
9	Right Front Fender	93.2	97	90	94
10	Right Front Door	76.0	75	79	75
11	Center Panel Right	92.3	94	92	91
12	Right Rear Door	93.3	97	94	90
13	Right Back Panel	103.8	105	99	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratched and cracked tail light,</p>