

General Information

Date & Time: 04, Mar, 2026 16:05

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	56,714
Registration No.	NGC9664	Chassis No.	PA1B18F36R4274075
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



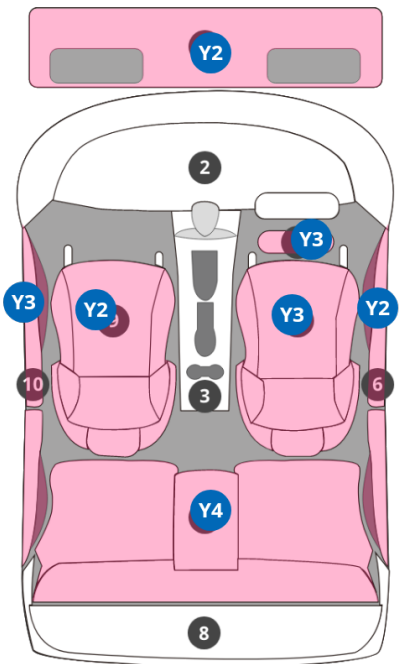
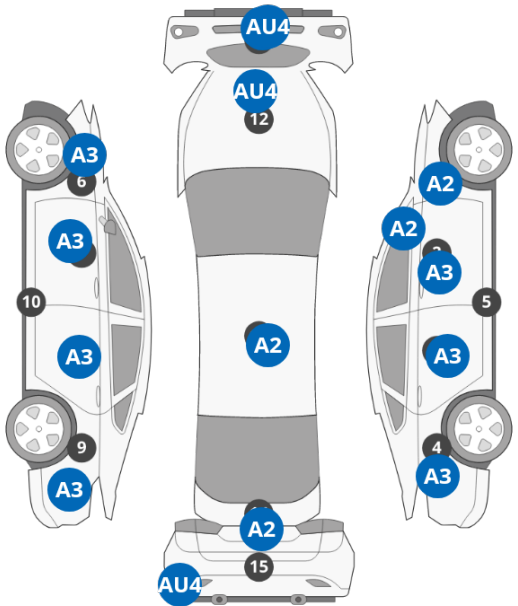
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	142	124	115
2	Boot Lid	104.7	96	112	106
3	Roof	94.1	100	95	88/93
4	Left Front Fender	99.2	100	97	101
5	Left Front Door	100.4	98	100	104
6	Center Panel Left				
7	Left Rear Door	102.1	108	100	99
8	Left Back Panel	101.2	106	98	100
9	Right Front Fender	108.0	110	109	105
10	Right Front Door	131.6	134	121	140
11	Center Panel Right				
12	Right Rear Door	101.6	100	98	107
13	Right Back Panel	104.4	95	101	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/plate light issue/with spare tire/No spare key/No seat cover/with reverse camera/with warranty booklet/with jack and incomplete tools/front bumper traces of dent/</p>