

General Information

Date & Time: 04, Mar, 2026 12:59

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	106,507
Registration No.	NHM7275	Chassis No.	PA2JA8EM4R0136561
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



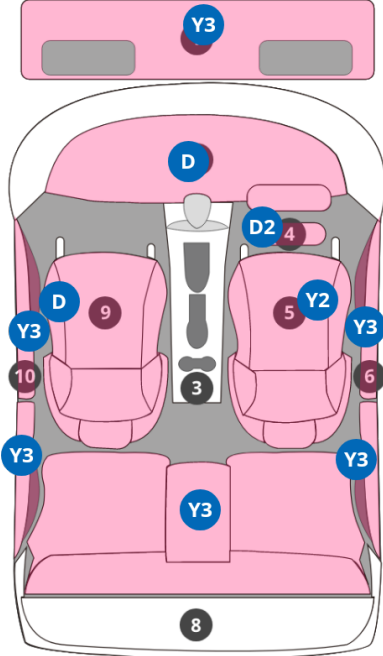
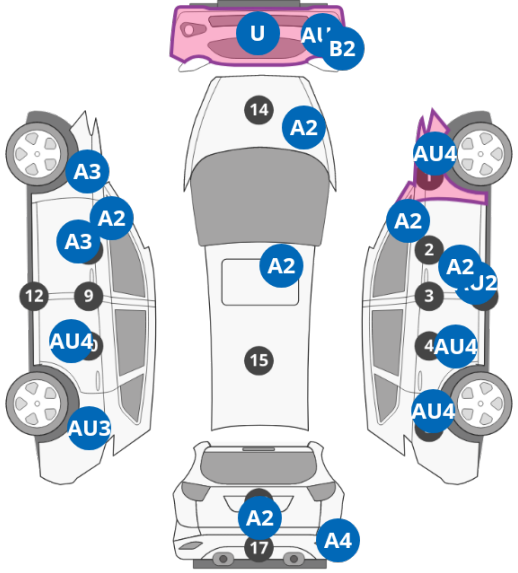
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.5	102	134	99
2	Boot Lid	112.0	116	114	106
3	Roof	99.6	121	85	95/97
4	Left Front Fender	102.5	102	99	107
5	Left Front Door	110.0	103	114	113
6	Center Panel Left				
7	Left Rear Door	107.0	108	107	106
8	Left Back Panel	111.6	108	118	109
9	Right Front Fender	102.6	100	105	103
10	Right Front Door	106.3	103	108	108
11	Center Panel Right				
12	Right Rear Door	98.8	99	95	103
13	Right Back Panel	104.3	108	103	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Center Panel - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Modified - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet and jack, with tools, with spare tire, with LTO plate, scratches on headlight and tail light, cracked tail light, plate light issue</p>