

General Information

Date & Time: 03, Mar, 2026 13:19

Make	Toyota	Model	Land Cruiser
YOM	2024	Odo Meter Reading	10,083
Registration No.	NKC1631	Chassis No.	JTMAA7BJ2P4070991
CC	3.3	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



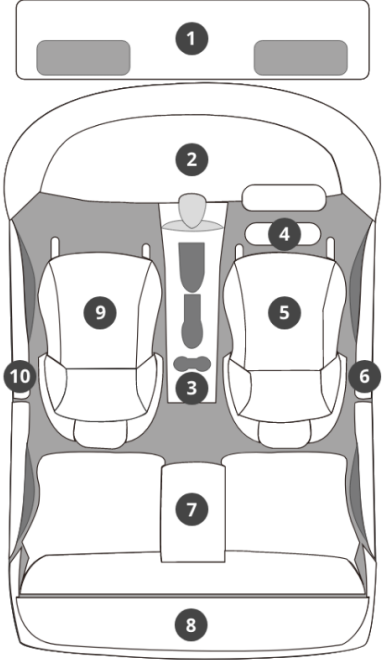
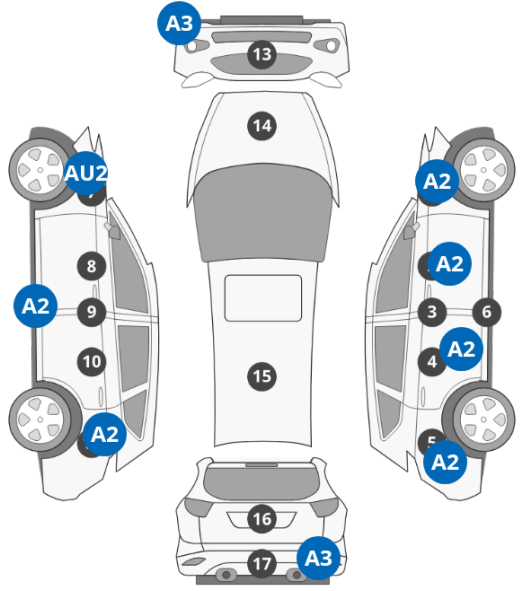
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	126	118	121
2	Boot Lid	126.3	123	141	115
3	Roof	126.0	108	116	142/138
4	Left Front Fender	107.0	110	105	106
5	Left Front Door	120.3	120	121	120
6	Center Panel Left				
7	Left Rear Door	122.3	126	118	123
8	Left Back Panel	135.0	133	138	134
9	Right Front Fender	100.6	100	101	101
10	Right Front Door	118.3	115	115	125
11	Center Panel Right				
12	Right Rear Door	112.6	108	115	115
13	Right Back Panel	137.6	138	141	134

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and LTO plate/ with jack and tools/ with spare tire/