

General Information

Date & Time: 03, Mar, 2026 13:43

Make	Toyota	Model	Corolla Altis
YOM	2020	Odo Meter Reading	18,695
Registration No.	NDM3515	Chassis No.	MR2BZ3BE0K2000038
CC	1.8	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Pearl White		

Body / Panel Condition



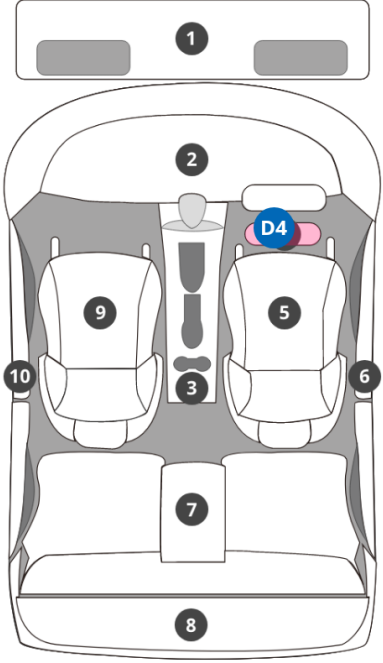
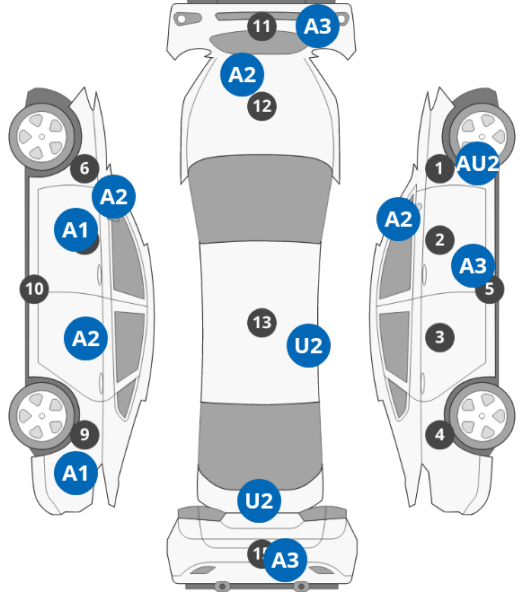
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	124	119	125
2	Boot Lid	111.3	103	129	102
3	Roof	138.7	137	141	137/140
4	Left Front Fender	124.0	133	130	109
5	Left Front Door	108.6	108	105	113
6	Center Panel Left				
7	Left Rear Door	111.6	123	110	102
8	Left Back Panel	112.3	113	120	104
9	Right Front Fender	126.6	113	135	132
10	Right Front Door	113.3	119	109	112
11	Center Panel Right				
12	Right Rear Door	114.0	108	115	119
13	Right Back Panel	115.0	100	127	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Worked - Large</p>		<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
with warranty booklet/ with tools and jack / with LTO plate and sparetire/