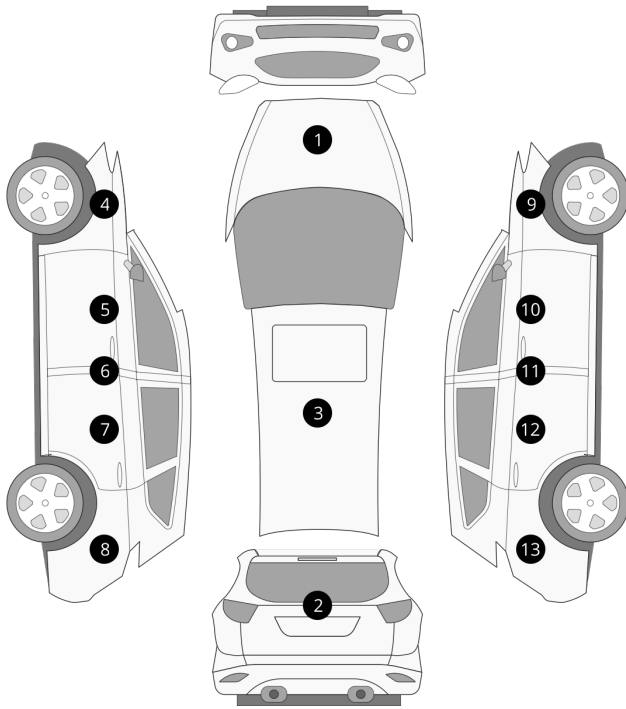


General Information

Date & Time: 03, Mar, 2026 13:27

Make	Toyota	Model	Camry
YOM	2024	Odo Meter Reading	24,085
Registration No.	NOV1597	Chassis No.	MR2B53HK3P4019980
CC	2.5	Transmission	CVT
Fuel Type	Hybrid	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



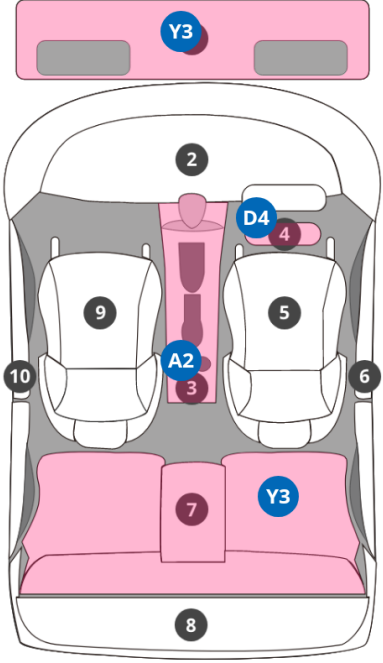
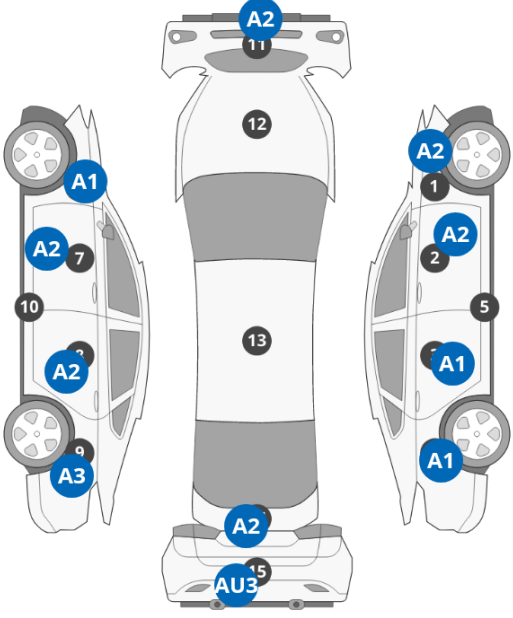
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	114	106	115
2	Boot Lid	109.3	111	100	117
3	Roof	135.2	114	123	111/193
4	Left Front Fender	114.6	116	114	114
5	Left Front Door	122.3	130	116	121
6	Center Panel Left				
7	Left Rear Door	125.0	132	124	119
8	Left Back Panel	111.0	114	117	102
9	Right Front Fender	117.0	126	113	112
10	Right Front Door	119.0	120	121	116
11	Center Panel Right				
12	Right Rear Door	146.6	126	158	156
13	Right Back Panel	134.6	112	138	154

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Large / Rear Seat - Grime - Medium</p>	<p>Remarks Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with jack and spare tire/ with LTO plate and warranty booklet / with tools</p>