

## General Information

Date & Time: 03, Mar, 2026 13:22

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2008	<b>Odo Meter Reading</b>	325,680
<b>Registration No.</b>	ZPA276	<b>Chassis No.</b>	KUN405022409
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



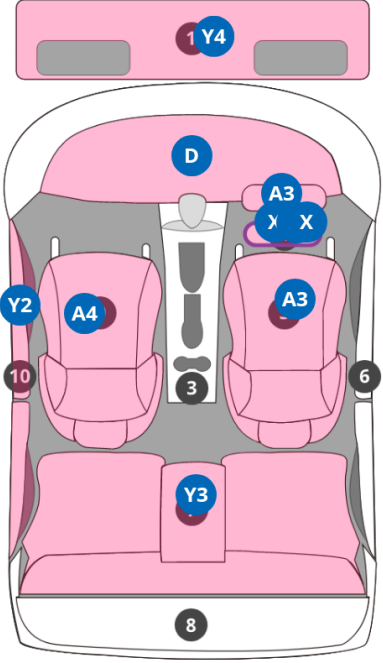
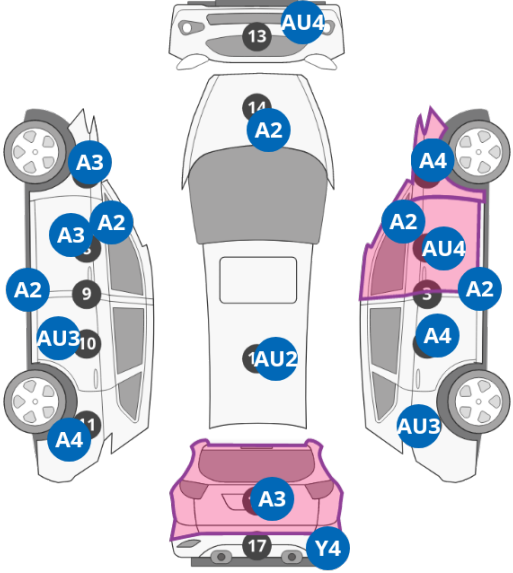
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	107	92	111
2	Boot Lid	428.0	122	1,028	134
3	Roof	117.4	90	92	115/173
4	Left Front Fender	125.0	148	114	113
5	Left Front Door	124.6	119	137	118
6	Center Panel Left				
7	Left Rear Door	160.0	158	181	141
8	Left Back Panel	201.0	200	164	239
9	Right Front Fender	139.6	147	129	143
10	Right Front Door	113.3	119	113	108
11	Center Panel Right				
12	Right Rear Door	129.6	133	118	138
13	Right Back Panel	135.0	122	117	166

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Cut, Crack - Large / Ceiling - Grime - Large / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No seat cover/No spare key/No fog light /plate light issue/No jack and tools/No reverse camera/back seat issue/No warranty booklet /seatbelts issue/Door lock issue/Sun visor issue/</p>