

General Information

Date & Time: 04, Mar, 2026 15:59

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	25,294
Registration No.	NKC8359	Chassis No.	PA1B18F34R4257467
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



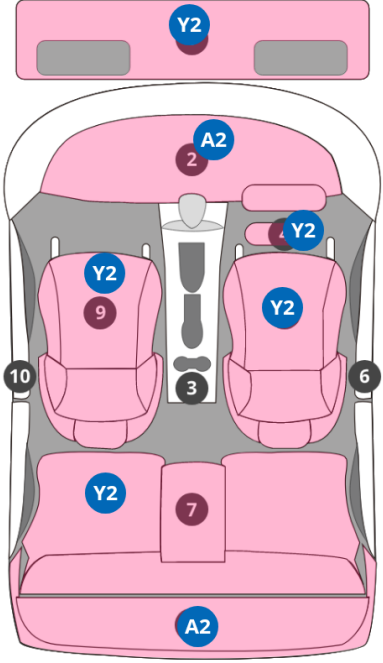
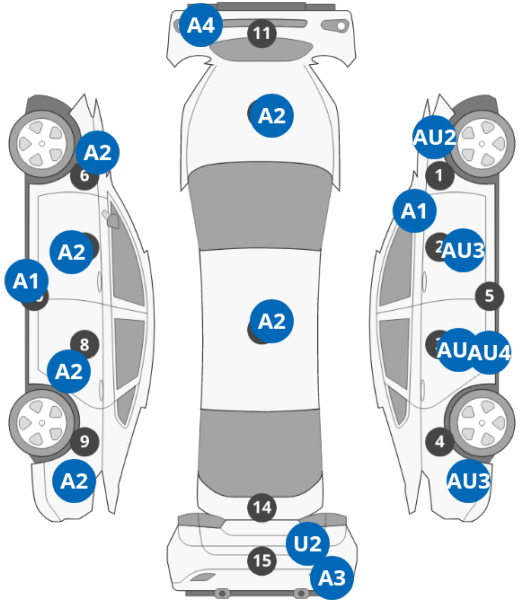
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	129	101	107
2	Boot Lid	101.5	100	100	105
3	Roof	98.4	108	96	92/98
4	Left Front Fender	103.5	100	105	106
5	Left Front Door	104.0	108	104	100
6	Center Panel Left				
7	Left Rear Door	109.3	110	109	109
8	Left Back Panel	113.6	119	114	108
9	Right Front Fender	104.3	109	103	101
10	Right Front Door	99.2	101	96	101
11	Center Panel Right				
12	Right Rear Door	104.0	99	103	110
13	Right Back Panel	108.2	100	100	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No seat cover/No warranty booklet/with jack and incomplete tools/with reverse camera/front left side fender issue/rear seat issue</p>