

## General Information

Date & Time: 03, Mar, 2026 10:24

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	30,878
<b>Registration No.</b>	NET2208	<b>Chassis No.</b>	PA1B18F33M4150340
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



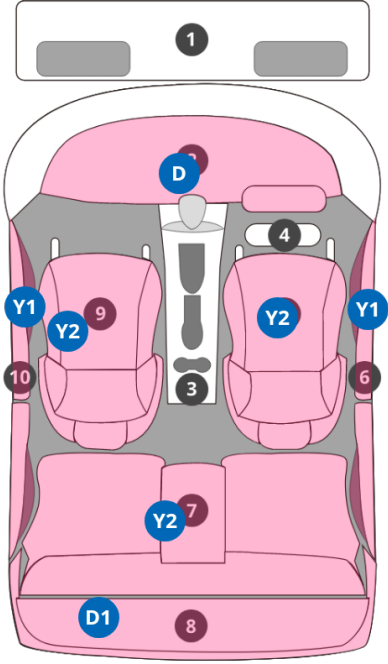
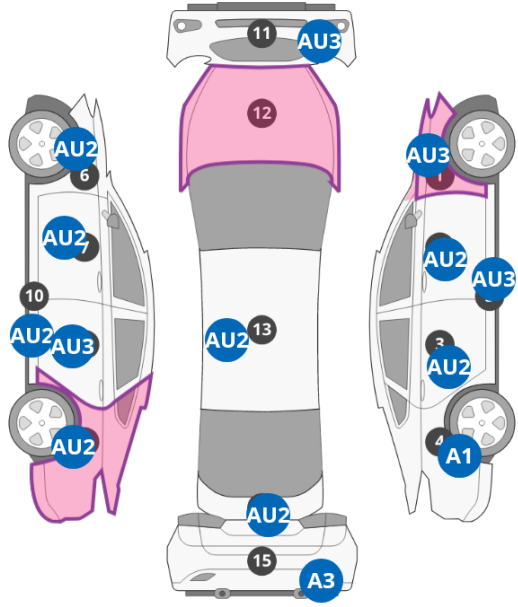
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	181.3	135	246	163
2	Boot Lid	114.0	126	97	119
3	Roof	126.0	130	132	138/104
4	Left Front Fender	98.0	94	97	103
5	Left Front Door	308.6	169	146	611
6	Center Panel Left				
7	Left Rear Door	91.7	105	83	87
8	Left Back Panel	420.6	683	285	294
9	Right Front Fender	236.0	199	200	309
10	Right Front Door	97.2	94	100	98
11	Center Panel Right				
12	Right Rear Door	97.8	102	94	98
13	Right Back Panel	108.6	101	128	97

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Trunk Room - Worked - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Right Front Pillar - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, with manual booklet, no spare key, with tools, check engine indicator on, scratches on headlight and tail light, no battery.</p>