

General Information

Date & Time: 10, Mar, 2026 13:27

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	10,181
Registration No.	GBK5333	Chassis No.	MR0DB8CD0S0196969
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



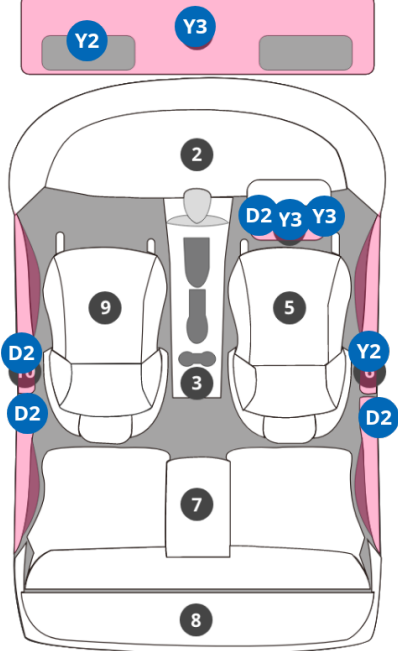
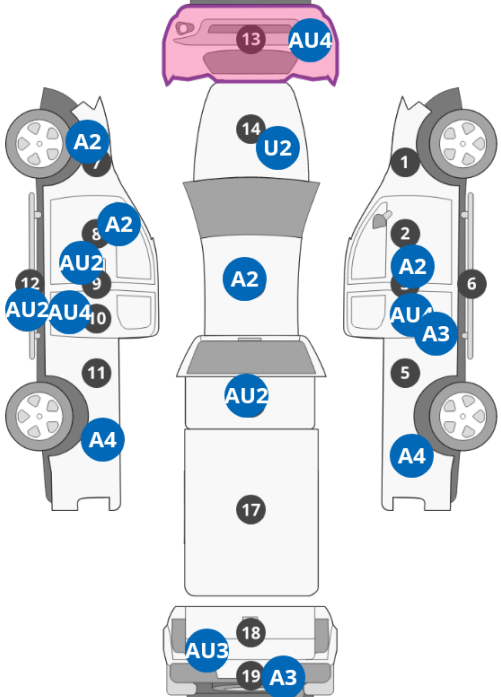
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	119	120	122
2	Boot Lid	97.9	100	100	94
3	Roof	109.1	106	98	122/111
4	Left Front Fender	99.3	99	98	101
5	Left Front Door	105.3	104	109	103
6	Center Panel Left				
7	Left Rear Door	103.8	105	107	100
8	Left Back Panel	104.3	105	105	103
9	Right Front Fender	99.7	100	101	99
10	Right Front Door	101.5	103	103	99
11	Center Panel Right				
12	Right Rear Door	103.7	98	107	106
13	Right Back Panel	100.1	100	105	96

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small / Mat Other - Grime - Medium / Ceiling - Grime - Medium / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Corner Panel - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Large / Cab Back Panel - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small / Roof - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Gap at glove box. Scratches at headlight and taillight. With warranty booklet, tools, jack, spare tire and seat cover. 1 key. No LTO plate.