

## General Information

Date & Time: 03, Mar, 2026 15:46

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	85,176
<b>Registration No.</b>	GAK8992	<b>Chassis No.</b>	PA1B18F38P4208883
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



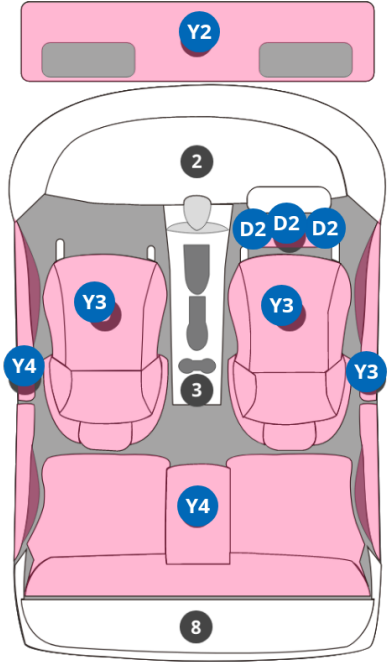
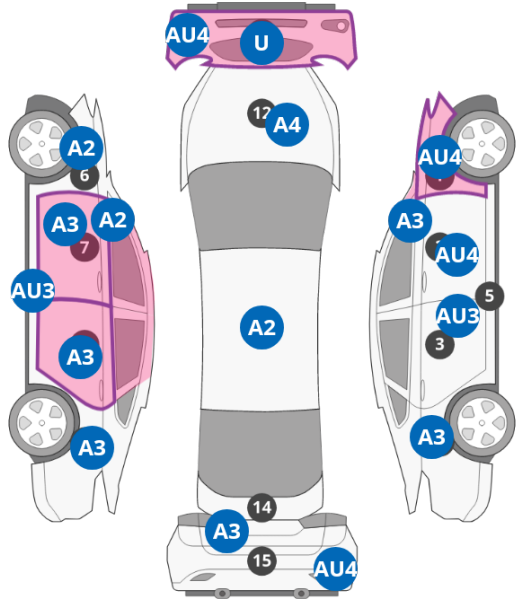
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	122	115	116
2	Boot Lid	114.0	113	114	115
3	Roof	105.7	109	101	103/110
4	Left Front Fender	103.0	106	102	101
5	Left Front Door	103.0	100	102	107
6	Center Panel Left				
7	Left Rear Door	108.3	117	107	101
8	Left Back Panel	109.6	110	106	113
9	Right Front Fender	103.3	99	105	106
10	Right Front Door	100.5	102	100	100
11	Center Panel Right				
12	Right Rear Door	141.3	141	143	140
13	Right Back Panel	109.0	102	107	118

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Large / Mat Other - Worked - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b>  (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Scratch - Small / Member (Bolted) - Dent - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b>  Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b>  Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<b>Inspector Notes</b>
Possible flooding. Head unit not working. Gap at frontbumper and front right fender. Without tools and seat cover. With warranty booklet, jack, and spare tire. 1 key. With LTO plate.