

## General Information

Date & Time: 03, Mar, 2026 16:05

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	16,122
<b>Registration No.</b>	GBJ8400	<b>Chassis No.</b>	MHKAA1BC3SJ037951
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



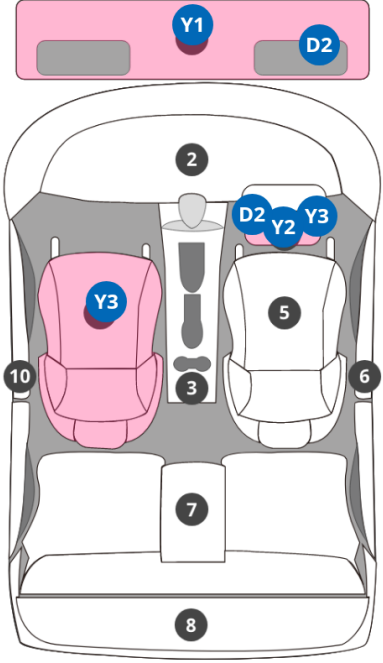
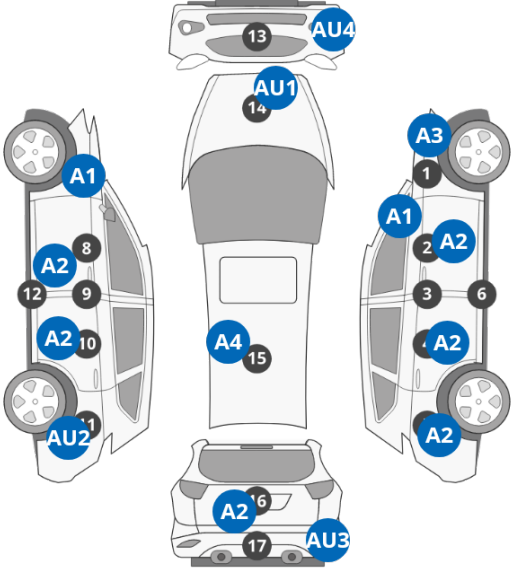
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>124.6</b>	125	123	126
2	Boot Lid	<b>118.3</b>	121	120	114
3	Roof	<b>113.0</b>	109	101	122/120
4	Left Front Fender	<b>106.0</b>	104	110	104
5	Left Front Door	<b>113.6</b>	118	106	117
6	Center Panel Left				
7	Left Rear Door	<b>110.6</b>	120	110	102
8	Left Back Panel	<b>108.6</b>	115	112	99
9	Right Front Fender	<b>101.7</b>	99	100	106
10	Right Front Door	<b>112.3</b>	116	110	111
11	Center Panel Right				
12	Right Rear Door	<b>113.3</b>	119	107	114
13	Right Back Panel	<b>105.6</b>	104	107	106

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Medium / Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Minimal / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Maintenance warning lamp. With warranty booklet, spare tire and jack. Incomplete seat cover. Without tools. 1 key. With LTO plate.</p>