

## General Information

Date & Time: 04, Mar, 2026 12:11

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	96,926
<b>Registration No.</b>	DAJ2036	<b>Chassis No.</b>	MHKA4DF5FJJ022481
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



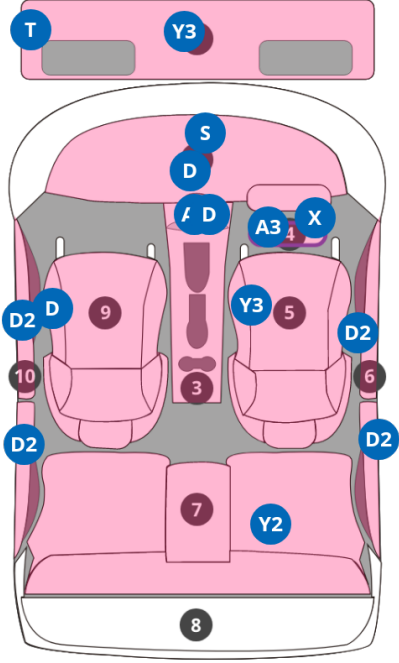
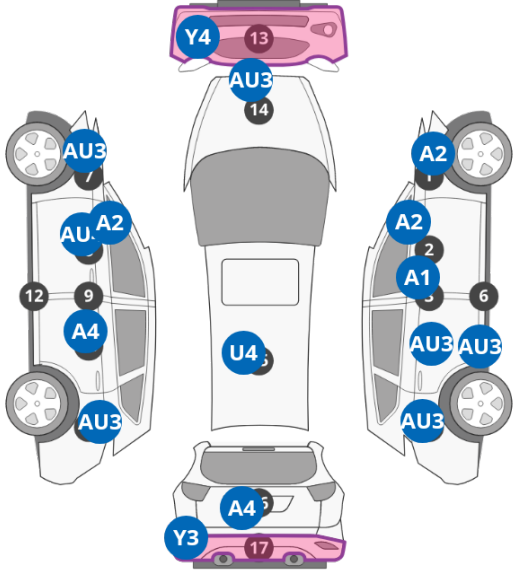
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.7	101	93	82
2	Boot Lid	219.0	216	222	219
3	Roof	85.9	72	85	94/93
4	Left Front Fender	181.3	177	180	187
5	Left Front Door	122.0	119	124	123
6	Center Panel Left				
7	Left Rear Door	93.8	94	94	93
8	Left Back Panel	90.8	88	97	88
9	Right Front Fender	116.6	112	107	131
10	Right Front Door	97.2	95	100	97
11	Center Panel Right				
12	Right Rear Door	94.6	99	93	91
13	Right Back Panel	278.6	313	367	156

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Small / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / (R) Front Floor Mat - Missing - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Cigarette Burns - Burnt, Hole</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Crack - Cracks / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium / Roof - Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Shift Shock - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, possible flooding, scratches on tail light and headlight, cracked tail light, park light issue, head unit issue, radio issue, rear door issue</p>