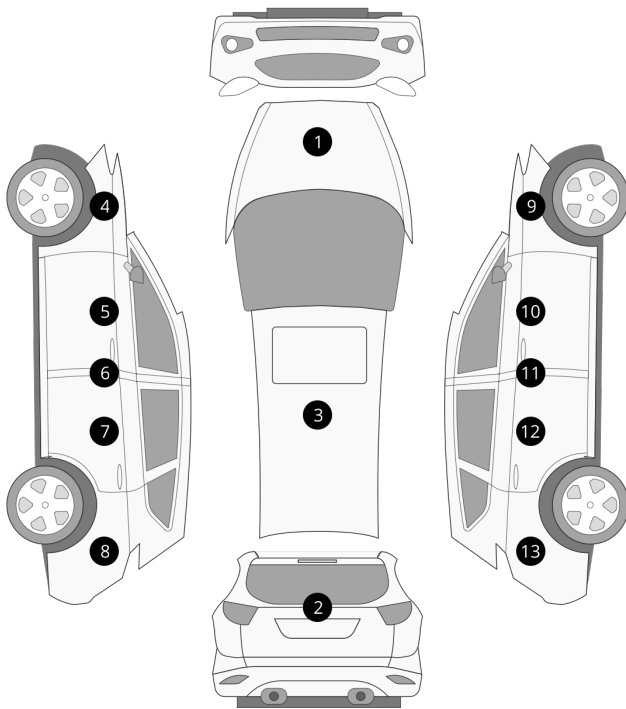


General Information

Date & Time: 09, Mar, 2026 09:03

Make	Mitsubishi	Model	Mirage
YOM	2025	Odo Meter Reading	5,188
Registration No.	NKN4149	Chassis No.	PAEA13RXSRA000424
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



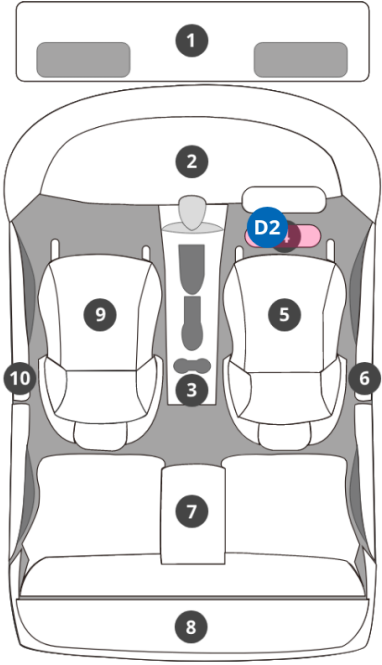
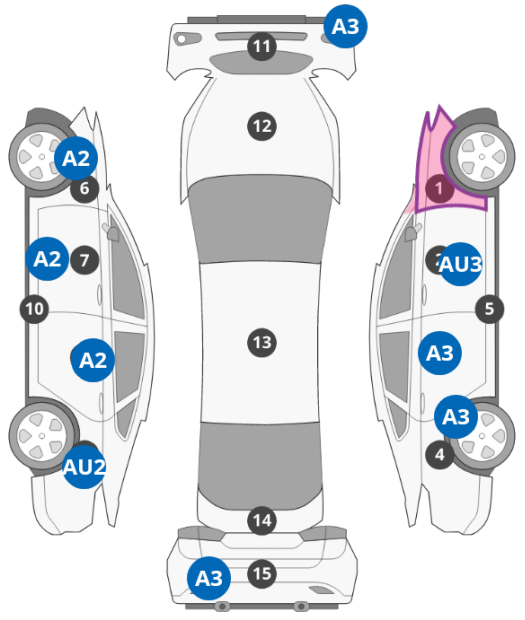
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	116	116	118
2	Boot Lid	101.8	97	109	100
3	Roof	100.5	93	106	94/109
4	Left Front Fender	107.5	108	97	118
5	Left Front Door	104.6	105	103	106
6	Center Panel Left				
7	Left Rear Door	102.6	102	100	106
8	Left Back Panel	114.0	118	118	106
9	Right Front Fender	106.6	113	103	104
10	Right Front Door	106.6	107	108	105
11	Center Panel Right				
12	Right Rear Door	103.7	105	99	107
13	Right Back Panel	106.3	100	109	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Partially Missing - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
incomplete tools/ with jack and spare tire/ with LTO plate and warranty booklet/