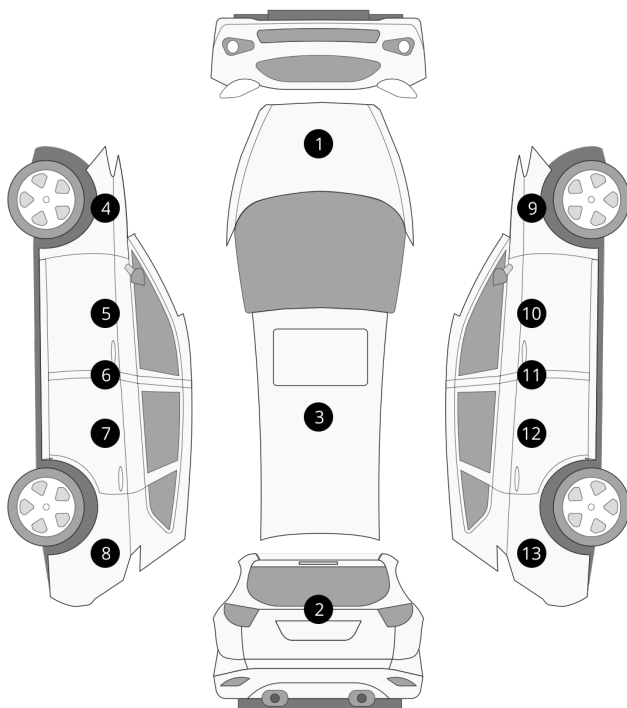


General Information

Date & Time: 10, Mar, 2026 16:42

Make	Toyota	Model	Hiace
YOM	2023	Odo Meter Reading	23,486
Registration No.	GBA8331	Chassis No.	JTFNAFAP3P8034082
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



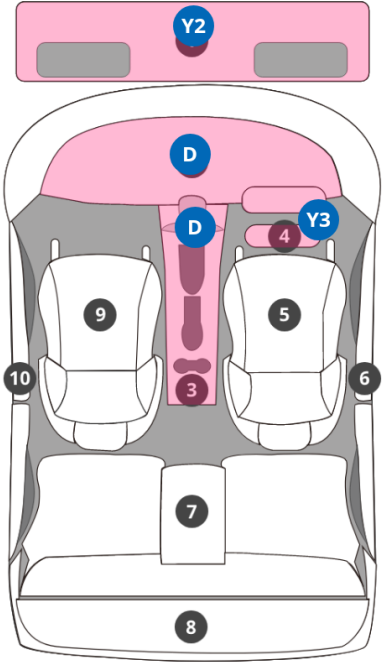
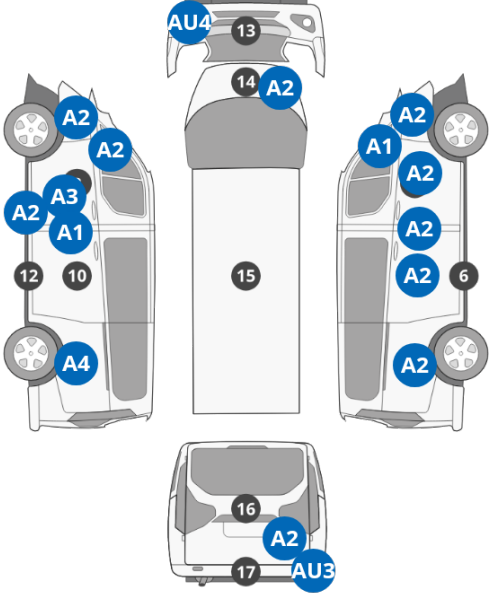
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.9	89	85	75
2	Boot Lid	73.3	73	75	73
3	Roof	79.0	76	72	85/83
4	Left Front Fender	86.3	91	85	83
5	Left Front Door	84.1	88	85	80
6	Center Panel Left	91.0	86	96	91
7	Left Rear Door				
8	Left Back Panel	81.3	77	84	84
9	Right Front Fender	85.7	83	85	89
10	Right Front Door	84.7	79	88	87
11	Center Panel Right	89.8	87	101	82
12	Right Rear Door	83.8	83	90	78
13	Right Back Panel	83.4	80	88	83

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (L) Center Panel - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. Scratches at front windshield. Without warranty booklet, tools and jack. With spare tire and seat cover. 1 key. With LTO plate.