

General Information

Date & Time: 10, Mar, 2026 16:11

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	34,034
Registration No.	GAK2413	Chassis No.	PA1B18F32P4203355
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



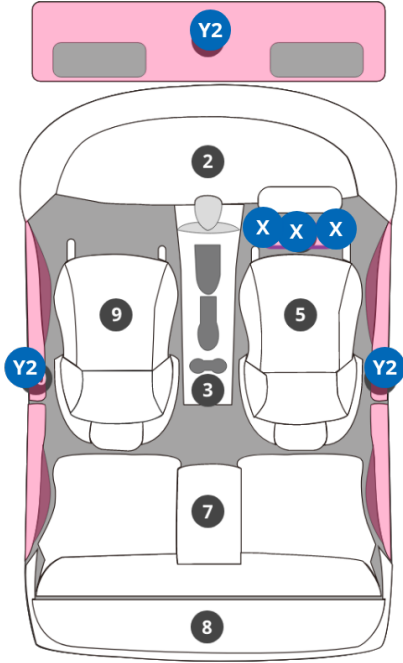
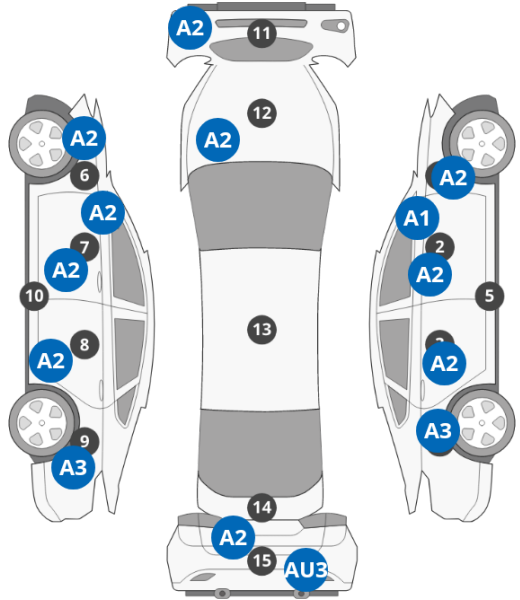
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	116	116	125
2	Boot Lid	229.3	392	144	152
3	Roof	100.3	110	93	95/103
4	Left Front Fender	100.4	108	99	95
5	Left Front Door	114.0	116	120	106
6	Center Panel Left				
7	Left Rear Door	112.6	113	107	118
8	Left Back Panel	114.0	120	110	112
9	Right Front Fender	100.5	100	102	100
10	Right Front Door	107.3	103	107	112
11	Center Panel Right				
12	Right Rear Door	108.3	109	107	109
13	Right Back Panel	108.0	108	103	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. Without warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. With LTO plate.