

General Information

Date & Time: 12, Mar, 2026 13:36

Make	Dongfeng	Model	Aeolus Mage
YOM	2025	Odo Meter Reading	1,113
Registration No.	NJE6429	Chassis No.	LGJE5EE07SM349761
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



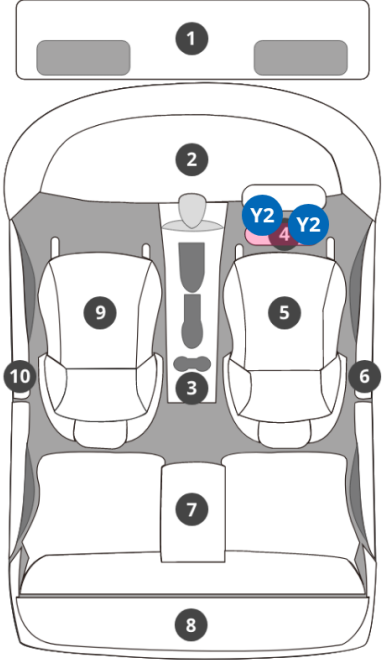
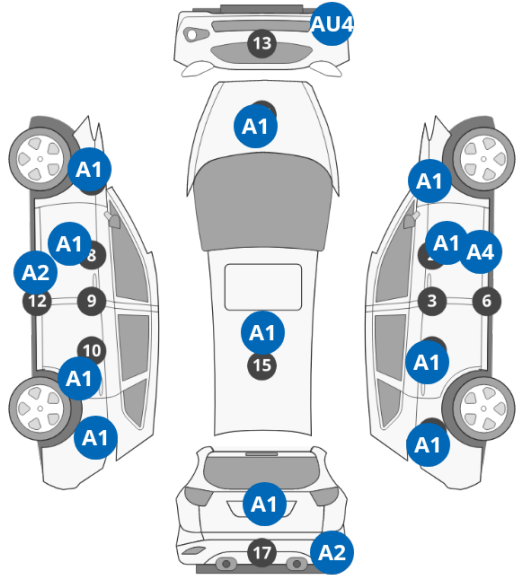
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	118	104	110
2	Boot Lid	98.1	95	97	102
3	Roof	118.7	107	117	128/123
4	Left Front Fender	115.3	116	119	111
5	Left Front Door	116.0	112	118	118
6	Center Panel Left				
7	Left Rear Door	113.1	125	115	100
8	Left Back Panel	112.6	111	106	121
9	Right Front Fender	119.3	109	128	121
10	Right Front Door	104.6	108	104	102
11	Center Panel Right				
12	Right Rear Door	109.5	98	116	115
13	Right Back Panel	112.6	120	114	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with warranty booklet/with spare tire/no tools and jack/door knob issue