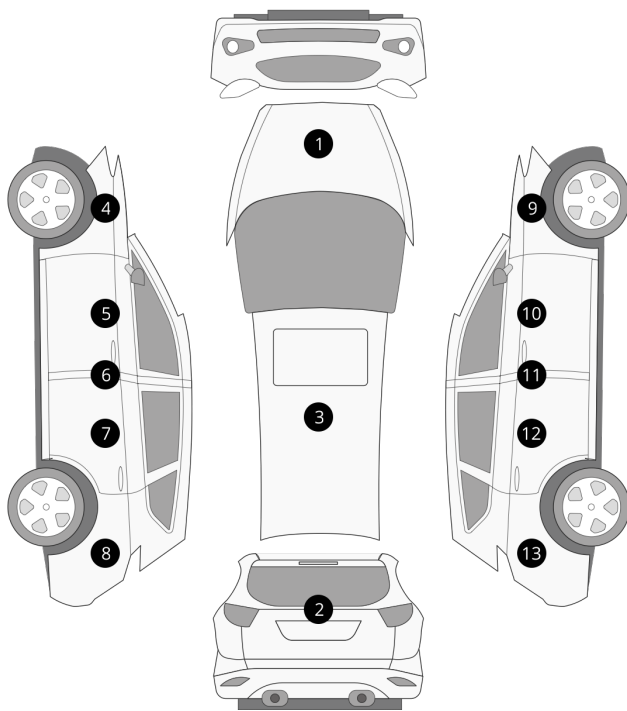


General Information

Date & Time: 17, Feb, 2025 09:08

Make	Toyota	Model	Vios
YOM	2023	Mileage	3,331
Registration No.	EAI8676	Chassis No.	PA1B18F31P4221975
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



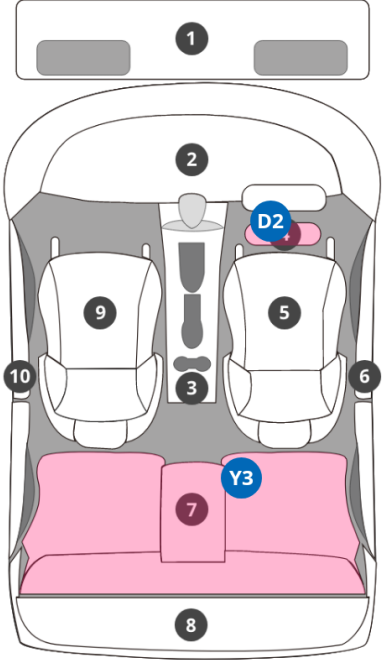
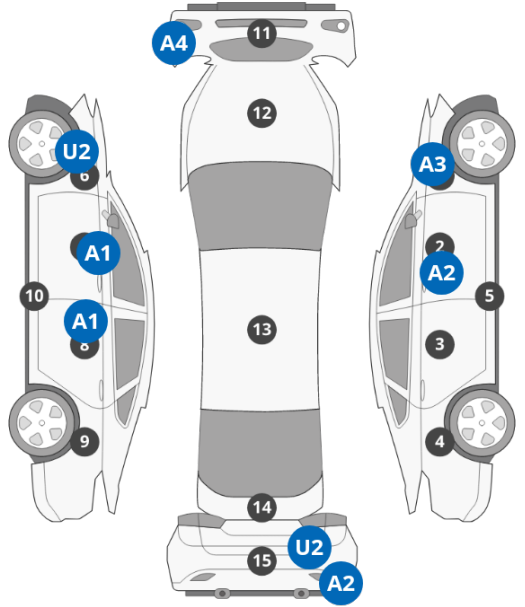
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	104	105	103
2	Boot Lid	109.1	97	118	113
3	Roof	106.7	102	101	110/114
4	Left Front Fender	94.8	93	98	94
5	Left Front Door	101.6	100	98	107
6	Center Panel Left				
7	Left Rear Door	106.3	114	103	102
8	Left Back Panel	103.1	112	100	98
9	Right Front Fender	100.3	99	96	106
10	Right Front Door	101.8	100	96	109
11	Center Panel Right				
12	Right Rear Door	101.1	97	100	107
13	Right Back Panel	110.5	97	119	116

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire, jack and tools/ no reverse camera/ power steering issue due to weak battery/ with warranty booklet/ No LTO plate