

## General Information

Date & Time: 27, Mar, 2026 09:01

|                  |            |                   |                  |
|------------------|------------|-------------------|------------------|
| Make             | Mitsubishi | Model             | Xpander          |
| YOM              | 2023       | Odo Meter Reading | 23,290           |
| Registration No. | NIP7702    | Chassis No.       | MK2LRNC1WPN02047 |
| CC               | 1.5        | Transmission      | A/T              |
| Fuel Type        | Gas        | Type of Body      | Wagon            |
| Colour           | Red        |                   |                  |

## Body / Panel Condition



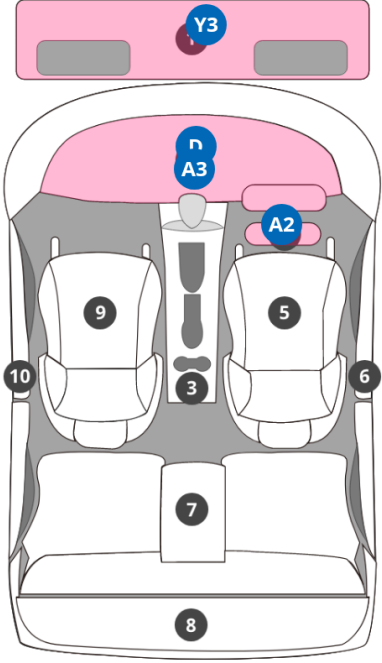
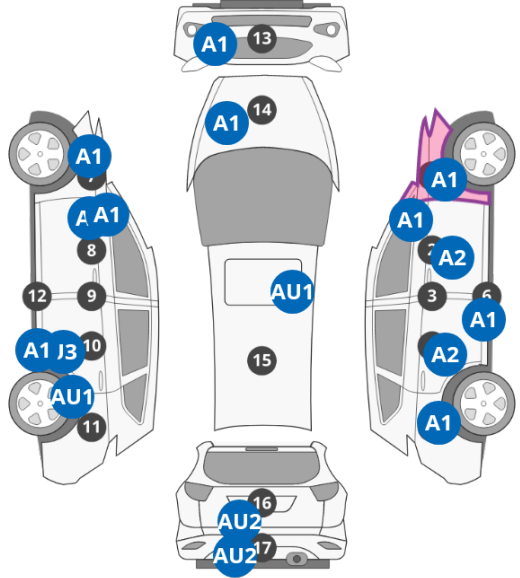
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 125.0         | 126    | 119    | 130      |
| 2  | Boot Lid           | 452.3         | 209    | 860    | 288      |
| 3  | Roof               | 123.0         | 138    | 129    | 125/100  |
| 4  | Left Front Fender  | 111.3         | 119    | 107    | 108      |
| 5  | Left Front Door    | 117.3         | 118    | 116    | 118      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 144.3         | 152    | 135    | 146      |
| 8  | Left Back Panel    | 175.6         | 185    | 178    | 164      |
| 9  | Right Front Fender | 314.3         | 680    | 130    | 133      |
| 10 | Right Front Door   | 95.2          | 102    | 97     | 87       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 138.6         | 132    | 138    | 146      |
| 13 | Right Back Panel   | 108.0         | 114    | 101    | 109      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>Remarks</b><br>Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Medium                                                                 | <b>Remarks</b><br>(R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                | <b>Remarks</b><br>Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

| Inspector Notes                                                                                                       |
|-----------------------------------------------------------------------------------------------------------------------|
| With Lto plate, with warranty booklet and spare tire, 1key, no jack and tools, scratches on headlights and taillights |