

General Information

Date & Time: 12, Sep, 2024 16:08

Make	Toyota	Model	Rush
YOM	2019	Mileage	50,887
Registration No.	NFT5622	Chassis No.	MHKE8FF3PKK014706
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



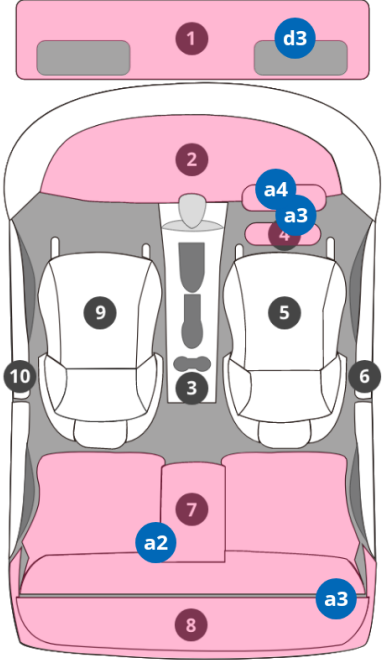
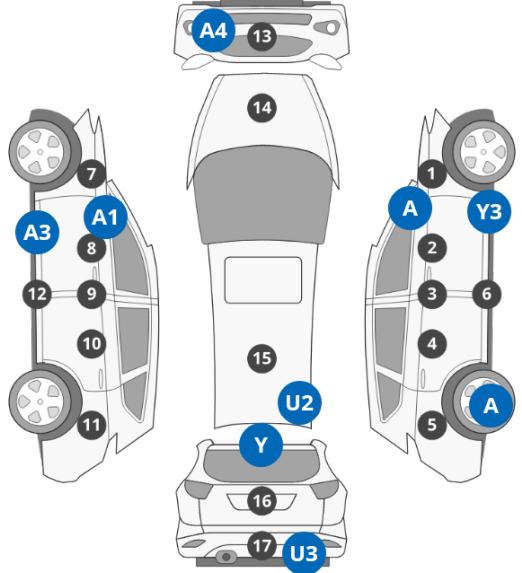
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	108	110	120
2	Boot Lid	132.3	128	129	140
3	Roof	104.6	79	116	118/106
4	Left Front Fender	242.3	332	212	183
5	Left Front Door	117.0	118	120	113
6	Center Panel Left				
7	Left Rear Door	97.2	91	100	101
8	Left Back Panel	107.6	104	109	110
9	Right Front Fender	111.6	104	116	115
10	Right Front Door	98.4	99	96	101
11	Center Panel Right				
12	Right Rear Door	93.6	96	94	92
13	Right Back Panel	112.3	113	112	112

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Lag - Cut, Crack - Medium / Steering Wheel - Worn, Peel, Crack - Large / Sunvisor, Sunglass Holder - Loose, Deformed, Grime - Medium / Seat belt Other - Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / Antennae - Damaged - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Roof - Dent - Small / (R) Mirror - Scratch, Peeled - Yes / (L) Mirror - Scratch, Peeled - Minimal / (R) Rear Tyre - Crack, Cut - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Audio, Radio - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
low battery key/ antenna missing / missing rear right reflector/ minimal interior and exterior scratches/ aftermarket tray(Cupholder)/low fuel