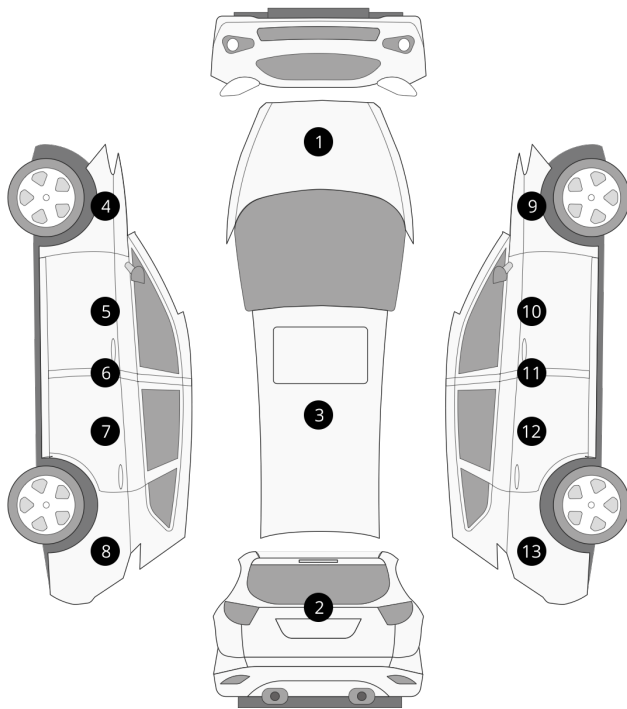


General Information

Date & Time: 15, Apr, 2026 08:27

Make	Nissan	Model	Almera
YOM	2025	Odo Meter Reading	3,428
Registration No.	BAG9007	Chassis No.	MNTBAAN18Z0061977
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



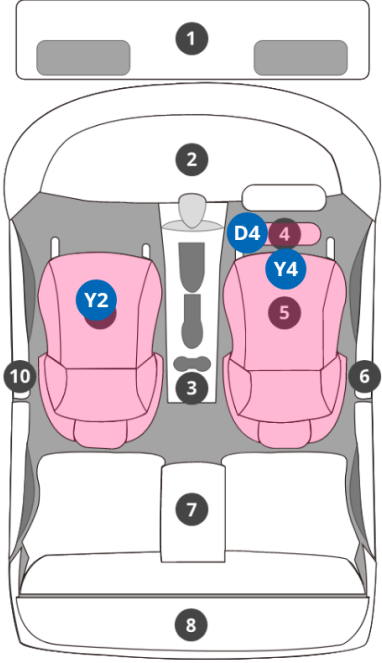
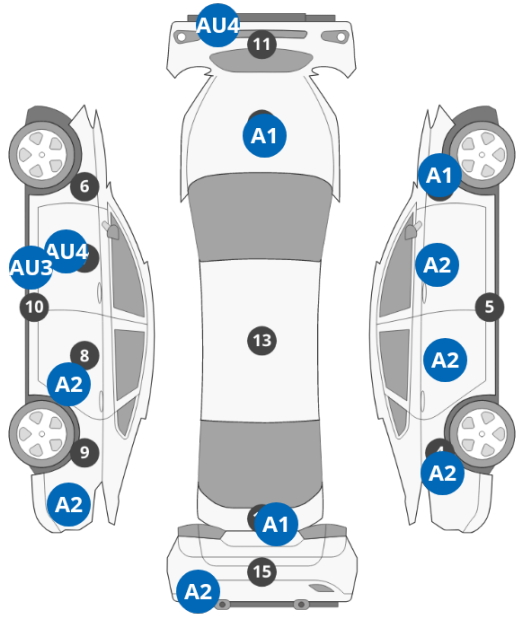
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.3	122	138	125
2	Boot Lid	127.0	129	127	125
3	Roof	130.7	131	134	148/110
4	Left Front Fender	133.0	123	140	136
5	Left Front Door	123.3	128	122	120
6	Center Panel Left				
7	Left Rear Door	113.0	110	117	112
8	Left Back Panel	131.3	142	131	121
9	Right Front Fender	121.3	115	112	137
10	Right Front Door	131.0	130	131	132
11	Center Panel Right				
12	Right Rear Door	124.3	133	115	125
13	Right Back Panel	371.6	620	252	243

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Battery - Weak - Yes

Inspector Notes
no tools and jack/ driver door issue/ with spare tire/ no warranty booklet/ with LTO plate/