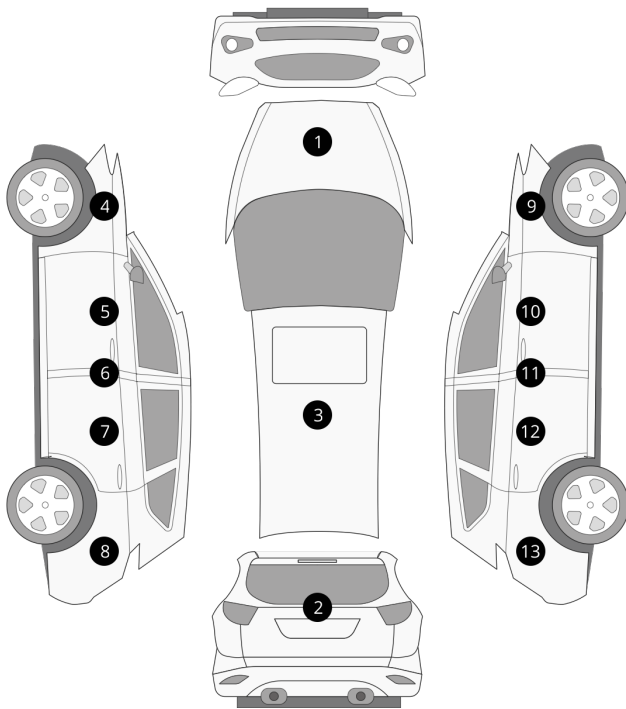


General Information

Date & Time: 15, Apr, 2026 17:03

Make	Mitsubishi	Model	Mirage
YOM	2025	Odo Meter Reading	12,221
Registration No.	NKM4926	Chassis No.	PAEA13MJSRA000211
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



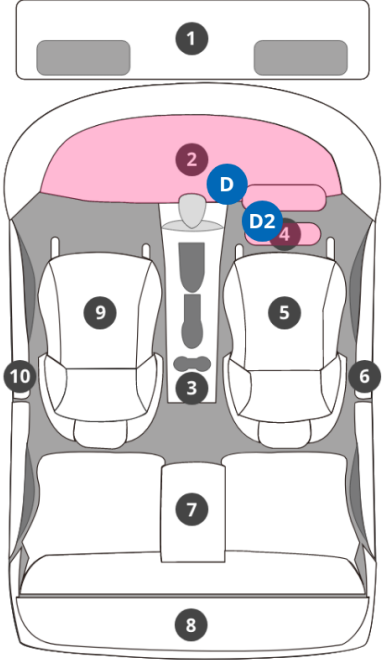
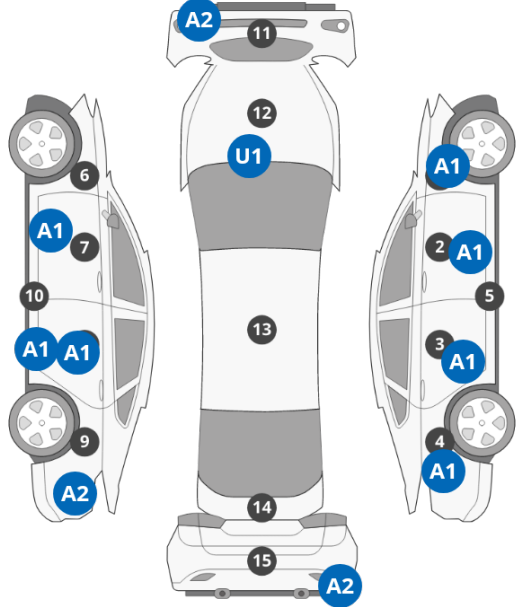
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	128	120	120
2	Boot Lid	107.0	111	101	109
3	Roof	113.7	122	106	121/106
4	Left Front Fender	119.0	123	123	111
5	Left Front Door	106.3	101	108	110
6	Center Panel Left				
7	Left Rear Door	111.0	114	116	103
8	Left Back Panel	117.3	107	124	121
9	Right Front Fender	103.3	101	103	106
10	Right Front Door	105.3	105	104	107
11	Center Panel Right				
12	Right Rear Door	104.0	102	106	104
13	Right Back Panel	106.1	98	110	111

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small	Remarks Bonnet, Headlight - Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
incomplete tools/ with jack and spare tire/ with LTO plate and warranty booklet/