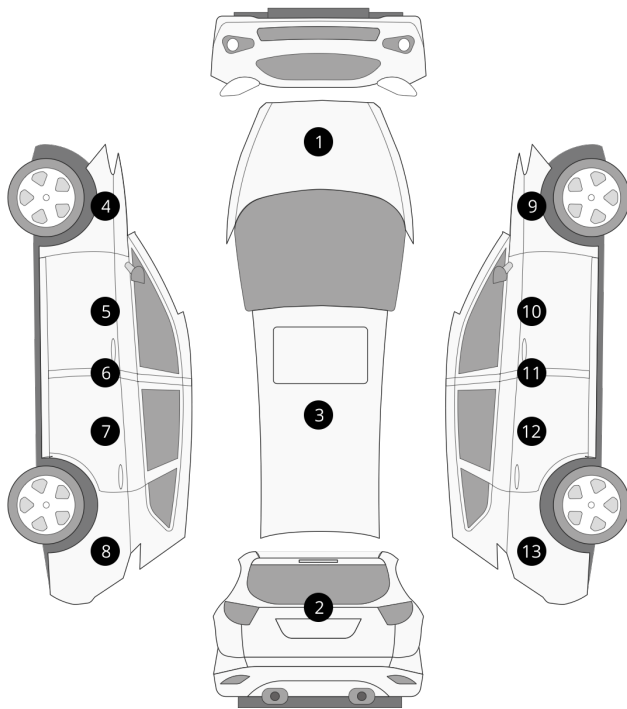


General Information

Date & Time: 15, Apr, 2026 17:20

Make	Nissan	Model	Livina
YOM	2025	Odo Meter Reading	9,574
Registration No.	NJQ8600	Chassis No.	MK2LRND1WNN00768
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



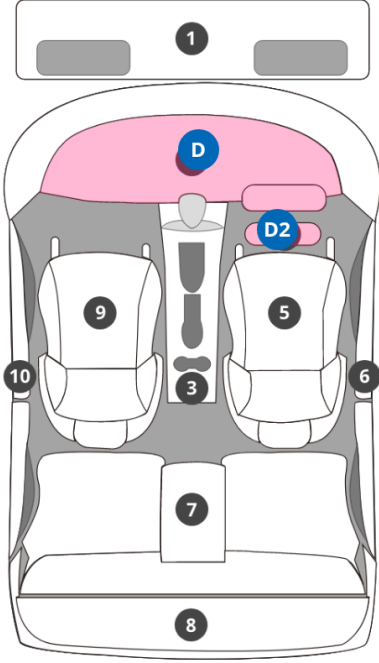
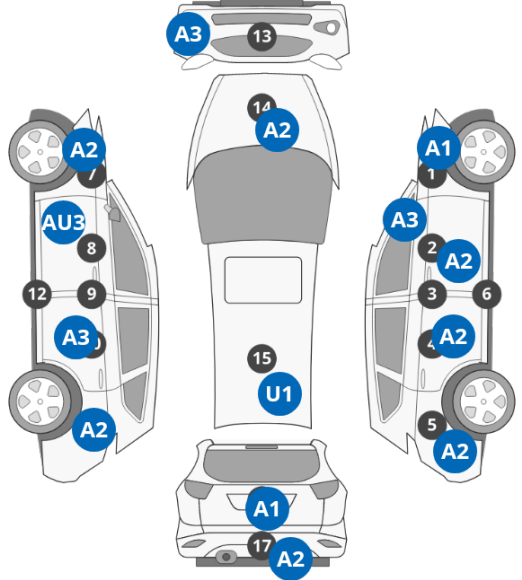
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.3	85	87	102
2	Boot Lid	101.8	108	113	85
3	Roof	93.2	88	87	98/100
4	Left Front Fender	98.9	99	106	92
5	Left Front Door	99.0	90	110	97
6	Center Panel Left				
7	Left Rear Door	97.5	94	100	99
8	Left Back Panel	101.6	98	101	106
9	Right Front Fender	93.0	86	86	107
10	Right Front Door	97.1	100	98	94
11	Center Panel Right				
12	Right Rear Door	97.5	97	97	99
13	Right Back Panel	93.8	100	81	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small	Remarks (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Medium / Roof - Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no tools/with jack and spare tire/ with LTO plate and warranty booklet/