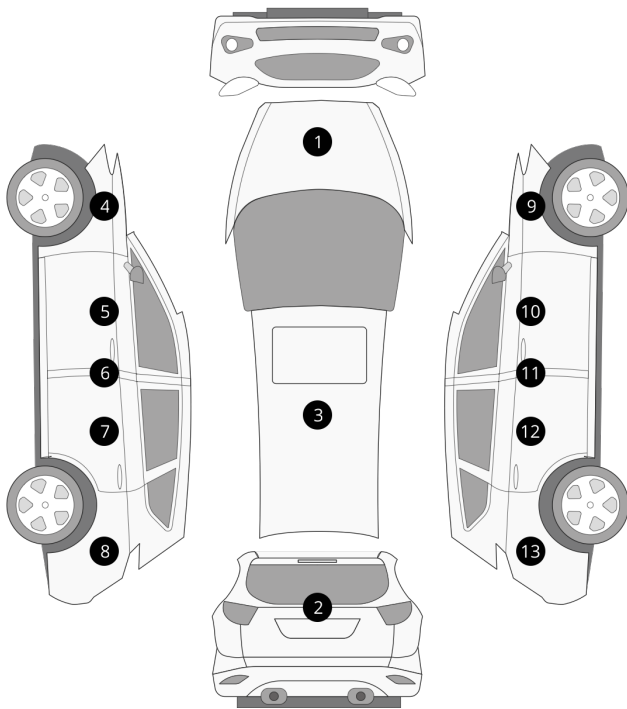


General Information

Date & Time: 15, Apr, 2026 17:22

Make	Geely	Model	Okavango
YOM	2025	Odo Meter Reading	13,048
Registration No.	NOV5539	Chassis No.	L6T7922Z3SY026321
CC	1.5	Transmission	A/T
Fuel Type	Hybrid	Type of Body	SUV
Colour	Black		

Body / Panel Condition



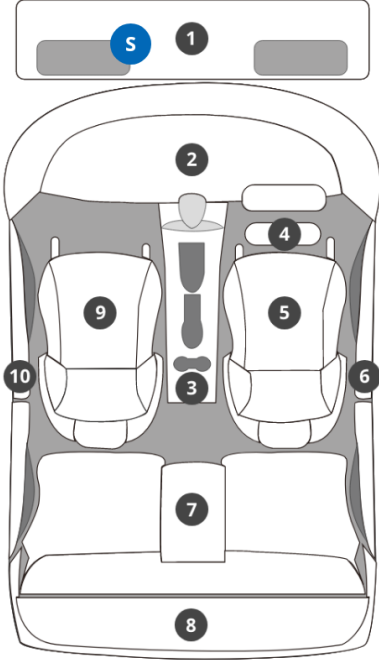
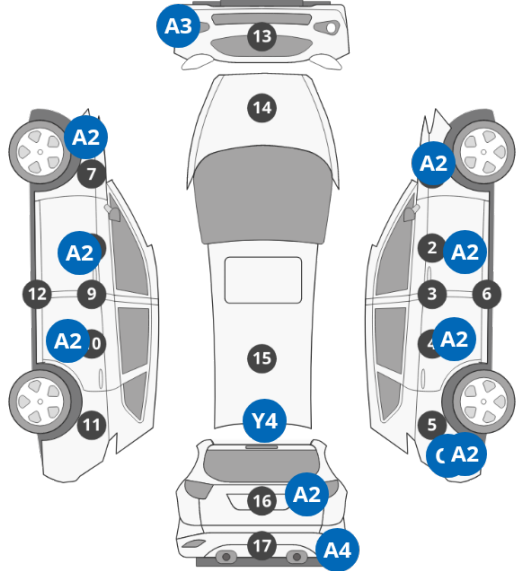
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	112	134	122
2	Boot Lid	106.5	103	96	121
3	Roof	125.0	124	125	125/126
4	Left Front Fender	121.6	125	122	118
5	Left Front Door	123.3	118	125	127
6	Center Panel Left				
7	Left Rear Door	121.6	123	110	132
8	Left Back Panel	113.3	116	117	107
9	Right Front Fender	119.0	125	115	117
10	Right Front Door	121.3	122	123	119
11	Center Panel Right				
12	Right Rear Door	121.3	127	120	117
13	Right Back Panel	113.6	113	110	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Rear Windshield - Damaged - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Remote Key & Smart entry - Issue - Yes

Inspector Notes
no jack and tools/ air-conditioning issue/ light scratches around the exterior/ reomet key issue/ with spare tire and LTO plate/ with warranty booklet/