

General Information

Date & Time: 16, Apr, 2026 15:07

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	29,407
Registration No.	NKF8153	Chassis No.	PAEA13RXRRA019532
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



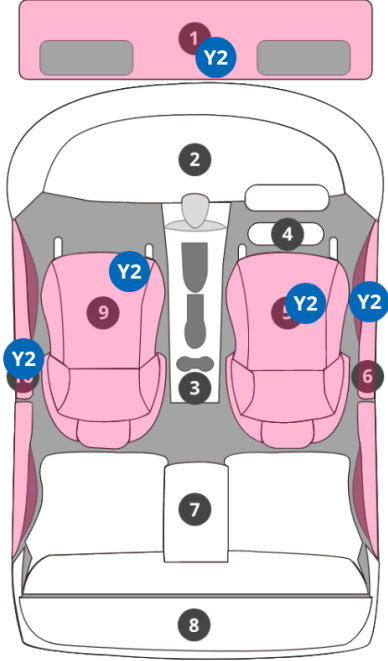
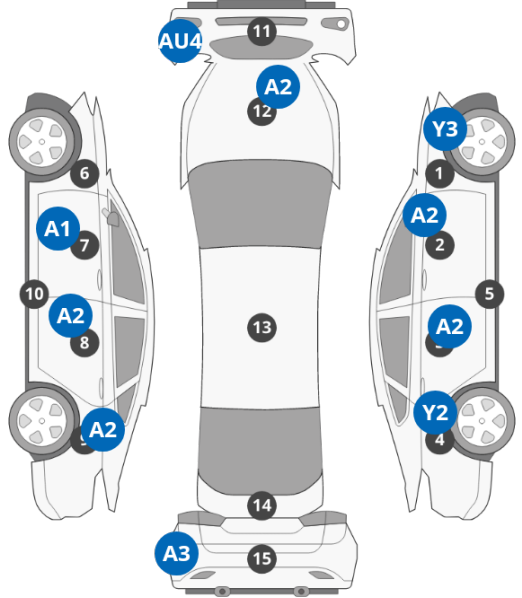
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.4	109	99	105
2	Boot Lid	95.7	85	107	95
3	Roof	87.9	78	95	86/93
4	Left Front Fender	130.6	128	134	130
5	Left Front Door	92.0	95	89	92
6	Center Panel Left				
7	Left Rear Door	88.7	95	85	86
8	Left Back Panel	98.2	97	96	102
9	Right Front Fender	582.3	372	124	1,251
10	Right Front Door	95.4	96	95	96
11	Center Panel Right				
12	Right Rear Door	92.5	87	93	98
13	Right Back Panel	96.0	102	95	92

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Crack, Gap - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
No Spare Tire. No Spare Key. No Warranty booklet. No seat cover. With Jack No tools. hairline scratch on left rear fender