

General Information

Date & Time: 20, Apr, 2026 16:22

Make	Honda	Model	City
YOM	2018	Odo Meter Reading	83,435
Registration No.	NAK6561	Chassis No.	PADGM6630JV415595
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



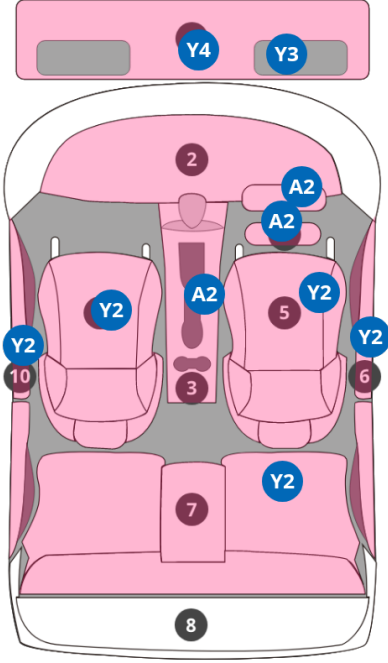
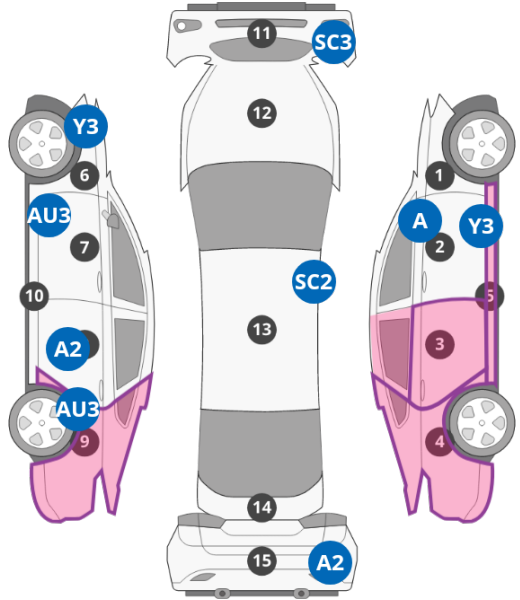
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	170.0	160	119	231
2	Boot Lid	325.0	217	403	355
3	Roof	168.7	161	174	189/151
4	Left Front Fender	236.3	227	267	215
5	Left Front Door	180.3	170	205	166
6	Center Panel Left				
7	Left Rear Door	259.6	229	290	260
8	Left Back Panel	561.6	418	505	762
9	Right Front Fender	408.3	623	356	246
10	Right Front Door	975.3	1,260	911	755
11	Center Panel Right				
12	Right Rear Door	197.0	208	156	227
13	Right Back Panel	533.3	261	467	872

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / Knobs - Worn, Peel, Crack - Small / Carpet - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Rust, Corrosion - Medium / (R) Mirror - Scratch, Peeled - Yes / Roof Spoiler, Molding - Rust, Corrosion - Small / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Partially Missing - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Overall Exterior - Full Re-Paint in same color - Yes
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Spare Tire. Punctured left rear tire. No Spare Key. No Warranty Booklet. No seat cover.