

General Information

Date & Time: 21, Apr, 2026 09:59

Make	Suzuki	Model	APV
YOM	2019	Odo Meter Reading	49,088
Registration No.	GAL1888	Chassis No.	MHYDN71V7LJ400265
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	Gray		

Body / Panel Condition



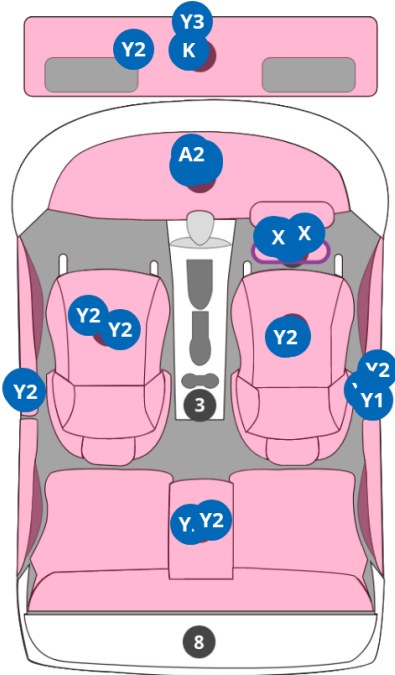
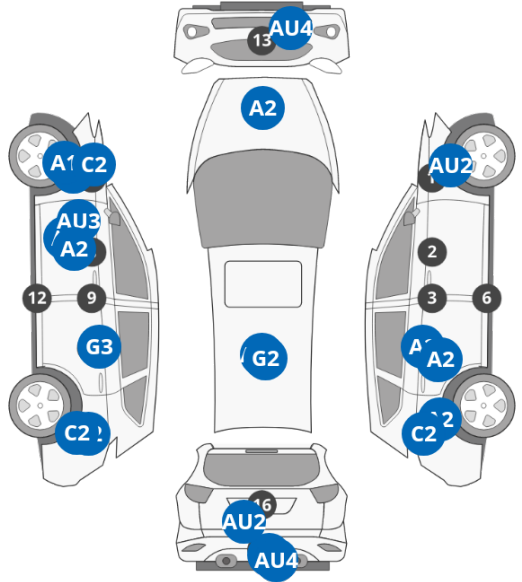
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	186.6	232	166	162
2	Boot Lid	507.0	956	229	336
3	Roof	340.5	525	194	202/441
4	Left Front Fender	141.0	122	138	163
5	Left Front Door	147.0	143	147	151
6	Center Panel Left				
7	Left Rear Door	247.6	208	372	163
8	Left Back Panel	164.6	171	153	170
9	Right Front Fender	175.0	182	159	184
10	Right Front Door	184.6	155	258	141
11	Center Panel Right				
12	Right Rear Door	208.3	194	178	253
13	Right Back Panel	158.3	160	156	159

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Dashboard - Repair Mark - Yes / Glove Box - Worn, Scratch, Cut, Crack - Small / Instrument Panel - Repair Mark - Yes / Steering Wheel - Worn, Peel, Crack - Small / Carpet - Worked - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / (R) Front Seat belt - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Seat belt - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Trim Other - Grime - Minimal / Rear Seat - Grime - Small / Seat belt Other - Grime - Small / Sunvisor, Sunglass Holder - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Supplemental Mirror - Scratch, Peeled - Minimal / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Side Window - Scratch, Stone chip - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / Muffler and Undercarriage Parts - Rust - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Power Seat - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Transmission issue. right headlight busted. Front room lamp issue and audio not working. Door lock switch issue. and without room lamp cover, Repaired right side mirror. Possible flooding. Watermarks at headlight. Both taillight busted. Paintmarks at bonnet. Without warranty booklet, seatcover, Tools and Jack. With LTO plate and 1 key.