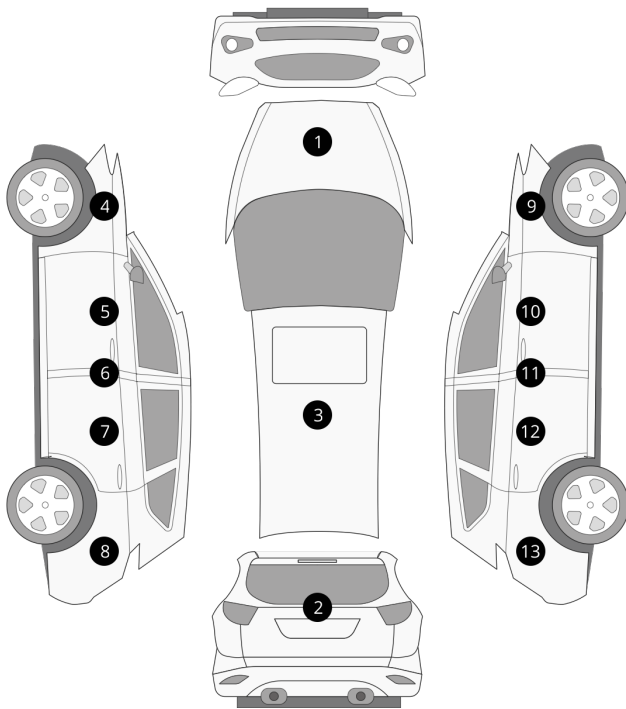


General Information

Date & Time: 29, Apr, 2026 11:13

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	49,580
Registration No.	DBQ4942	Chassis No.	PA1B18F35R4269305
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



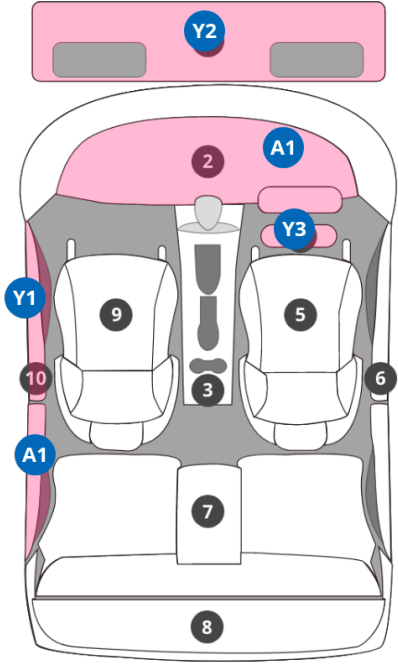
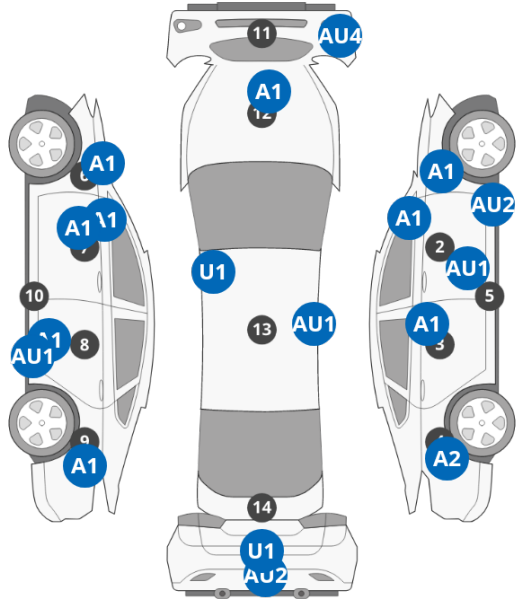
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	114	113	108
2	Boot Lid	117.0	119	107	125
3	Roof	97.5	105	93	97/95
4	Left Front Fender	100.6	100	101	101
5	Left Front Door	102.9	97	101	111
6	Center Panel Left				
7	Left Rear Door	112.3	122	108	107
8	Left Back Panel	112.3	117	112	108
9	Right Front Fender	109.0	105	110	112
10	Right Front Door	105.0	109	100	106
11	Center Panel Right				
12	Right Rear Door	107.0	101	102	118
13	Right Back Panel	106.3	104	101	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Minimal / (L) Rear Trim - Cut, Crack - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof Spoiler, Molding - Dent - Minimal / Roof - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, battery weak,R fender light issue,