

General Information

Date & Time: 25, Apr, 2026 16:05

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	13,297
Registration No.	CCQ4155	Chassis No.	PA1B18F3XS4296232
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



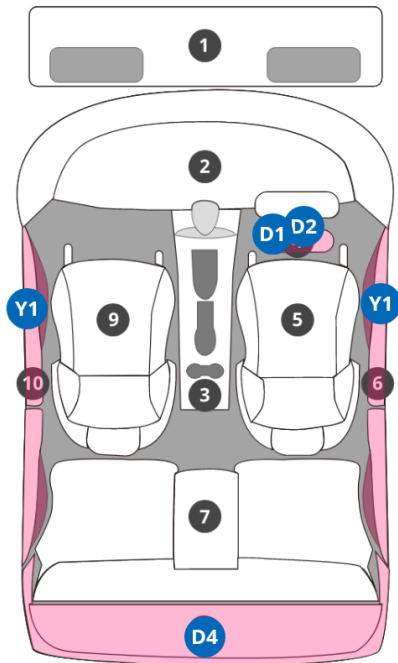
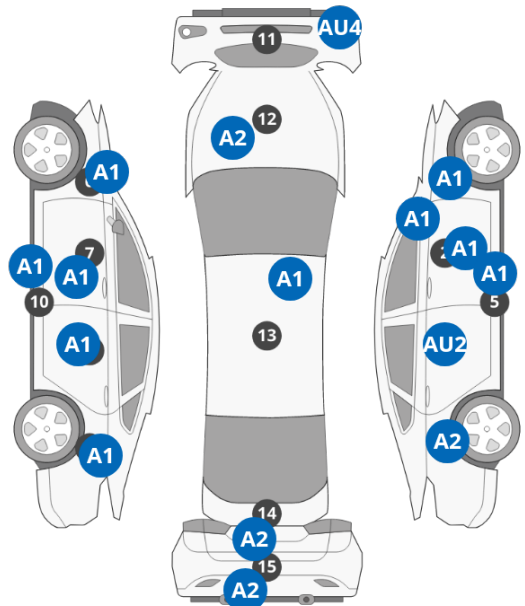
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	126	110	127
2	Boot Lid	127.6	130	118	135
3	Roof	103.7	103	108	104/100
4	Left Front Fender	111.0	104	109	120
5	Left Front Door	109.6	115	111	103
6	Center Panel Left				
7	Left Rear Door	109.6	114	107	108
8	Left Back Panel	114.0	121	109	112
9	Right Front Fender	116.0	116	122	110
10	Right Front Door	112.6	112	112	114
11	Center Panel Right				
12	Right Rear Door	115.6	117	109	121
13	Right Back Panel	117.6	111	109	133

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Loose, Deformed - Large / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

No Lto plate, with warranty booklet and jack, 1key, no spare tire and tools, scratches on headlights and taillights, hood stand missing, trunk room cover missing, popped up airbag warning lamp on