

General Information

Date & Time: 27, Apr, 2026 08:56

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	43,891
Registration No.	NJK1417	Chassis No.	PA1B18F35S4297434
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



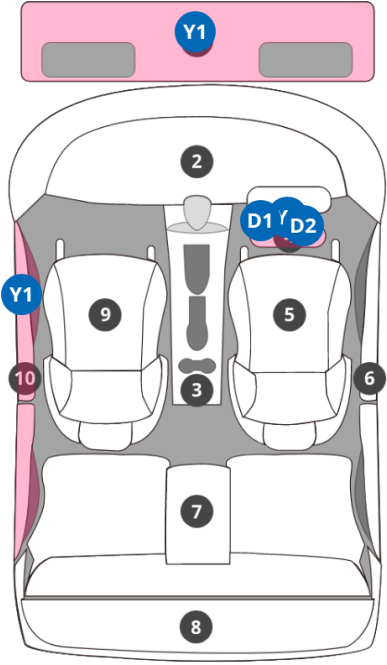
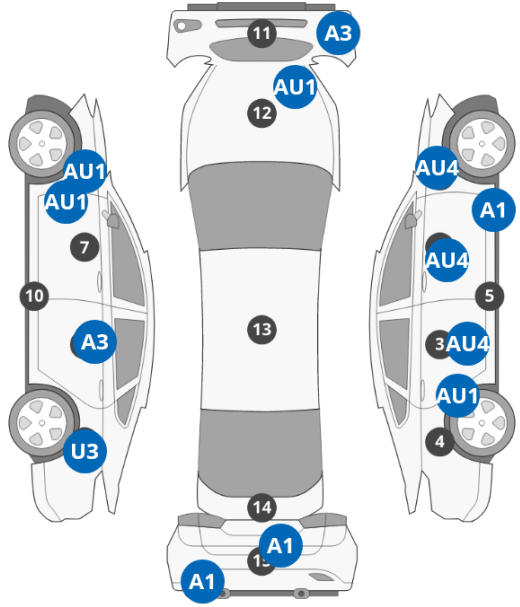
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	127	120	116
2	Boot Lid	116.3	117	109	123
3	Roof	101.2	109	99	100/97
4	Left Front Fender	105.3	107	100	109
5	Left Front Door	105.3	106	106	104
6	Center Panel Left				
7	Left Rear Door	105.0	104	101	110
8	Left Back Panel	115.6	129	107	111
9	Right Front Fender	115.0	116	119	110
10	Right Front Door	113.0	117	108	114
11	Center Panel Right				
12	Right Rear Door	115.0	107	116	122
13	Right Back Panel	113.0	117	113	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire, with jack and tools, 1key, no warranty booklet, scratches on headlights and taillights, left fender light issue, cover under hood missing, hood stand issue