

## General Information

Date & Time: 29, Apr, 2026 15:56

|                  |                   |                   |                   |
|------------------|-------------------|-------------------|-------------------|
| Make             | Toyota            | Model             | Vios              |
| YOM              | 2022              | Odo Meter Reading | 95,432            |
| Registration No. | CAW8741           | Chassis No.       | PA1B18F36M4161672 |
| CC               | 1.3               | Transmission      | CVT               |
| Fuel Type        | Gas               | Type of Body      | Sedan             |
| Colour           | Blackish Red Mica |                   |                   |

## Body / Panel Condition



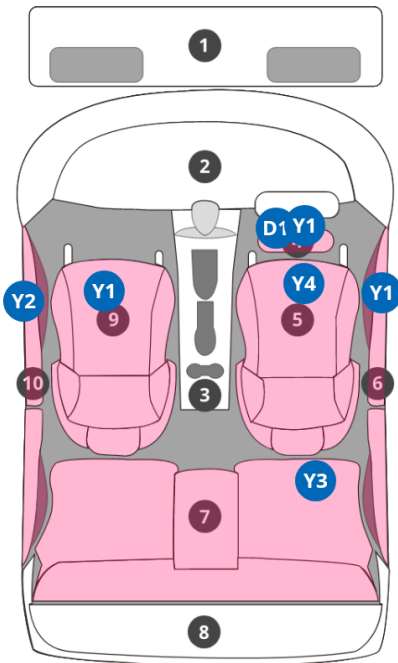
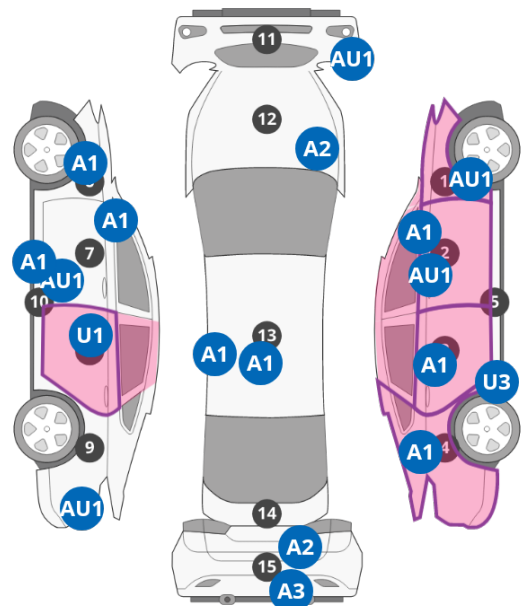
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 111.6         | 114    | 108    | 113      |
| 2  | Boot Lid           | 115.1         | 125    | 96     | 124      |
| 3  | Roof               | 94.8          | 94     | 98     | 94/94    |
| 4  | Left Front Fender  | 92.4          | 93     | 87     | 98       |
| 5  | Left Front Door    | 99.8          | 106    | 101    | 93       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 211.6         | 158    | 212    | 265      |
| 8  | Left Back Panel    | 111.0         | 112    | 110    | 111      |
| 9  | Right Front Fender | 505.6         | 94     | 858    | 565      |
| 10 | Right Front Door   | 180.0         | 162    | 187    | 191      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 221.0         | 186    | 203    | 274      |
| 13 | Right Back Panel   | 235.0         | 151    | 175    | 379      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                          |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                       | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>       |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>Remarks</b><br>(R) Front Seat - Grime - Large / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Floor Mat - Grime - Minimal | <b>Remarks</b><br>(R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Re-Paint Uneven - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / Roof Spoiler, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                          | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                      | <b>Remarks</b><br>Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |

|                        |
|------------------------|
| <b>Inspector Notes</b> |
|------------------------|

With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, battery weak, R fender lights issue