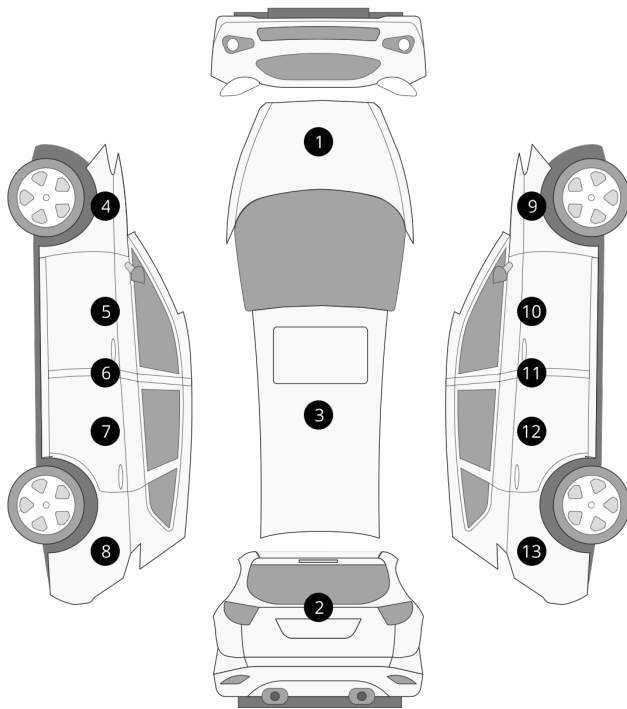


General Information

Date & Time: 29, Apr, 2026 16:01

Make	Nissan	Model	Almera
YOM	2017	Odo Meter Reading	40,394
Registration No.	CAD1594	Chassis No.	BDUALGAN17B77756
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



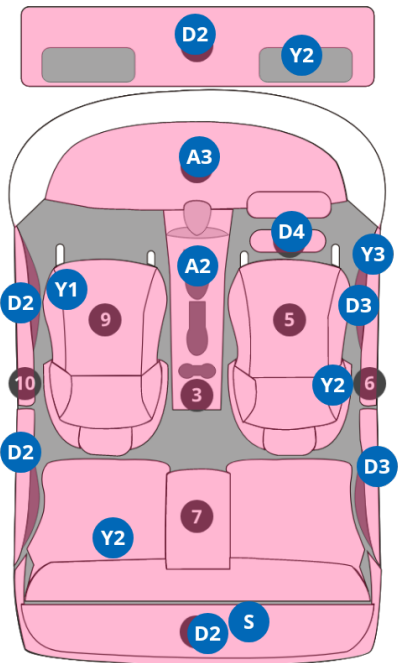
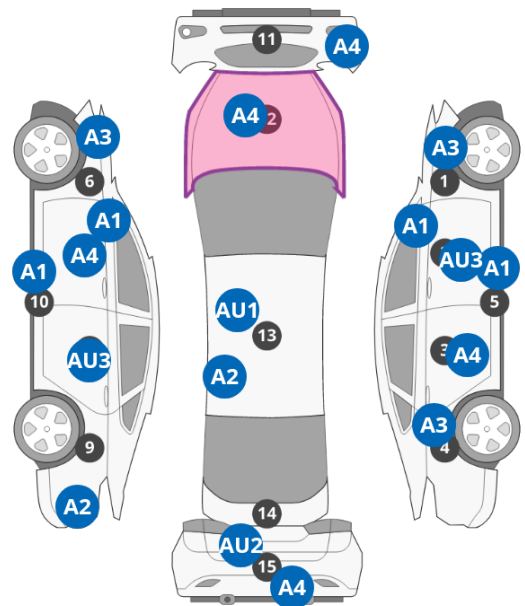
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	584.0	251	1,233	268
2	Boot Lid	198.6	199	199	198
3	Roof	117.0	120	117	109/122
4	Left Front Fender	205.3	193	193	230
5	Left Front Door	256.6	143	166	461
6	Center Panel Left				
7	Left Rear Door	164.6	182	124	188
8	Left Back Panel	229.6	237	202	250
9	Right Front Fender	204.0	182	211	219
10	Right Front Door	146.6	144	152	144
11	Center Panel Right				
12	Right Rear Door	304.0	265	388	259
13	Right Back Panel	248.0	265	223	256

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Small / (R) Rear Trim - Loose, Deformed - Medium / (R) Front Trim - Loose, Deformed - Medium / Trim Other - Grime - Medium / Carpet - Worked - Large / Trunk Room - Loose, Deformed - Small / (L) Rear Trim - Loose, Deformed - Small / Rear Seat - Grime - Small / (L) Front Trim - Loose, Deformed - Small / Steering Wheel - Worn, Peel, Crack - Medium / Knobs - Worn, Peel, Crack - Small / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Seat - Grime - Minimal / Overall Interior - Smell - Yes / (R) Front Seat belt - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Minimal / Roof Spoiler, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, faded headlights, scratches on taillights, foul smell, possible flooding, battery weak, ,hood release lever issue,