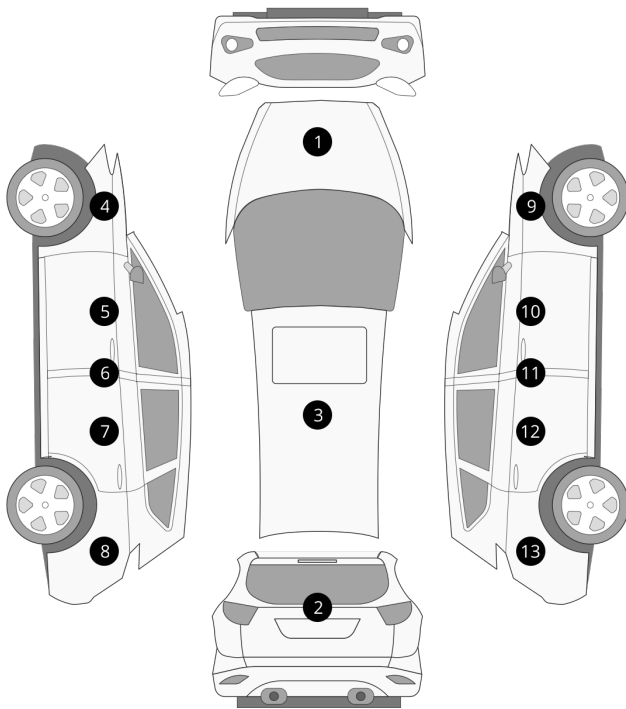


General Information

Date & Time: 28, Apr, 2026 18:38

Make	Toyota	Model	Yaris Cross
YOM	2024	Odo Meter Reading	7,483
Registration No.	DBP7142	Chassis No.	MHFAA8AF3R0021199
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



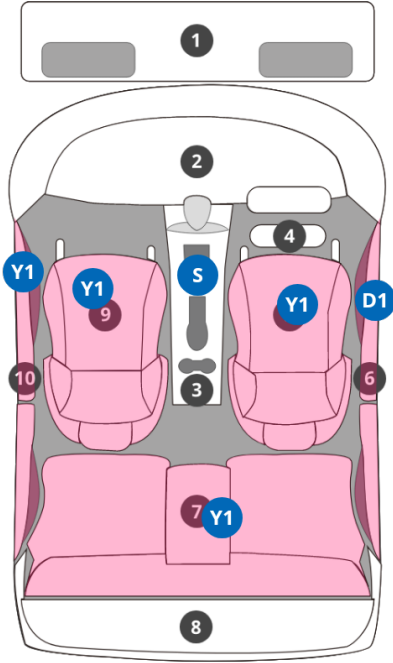
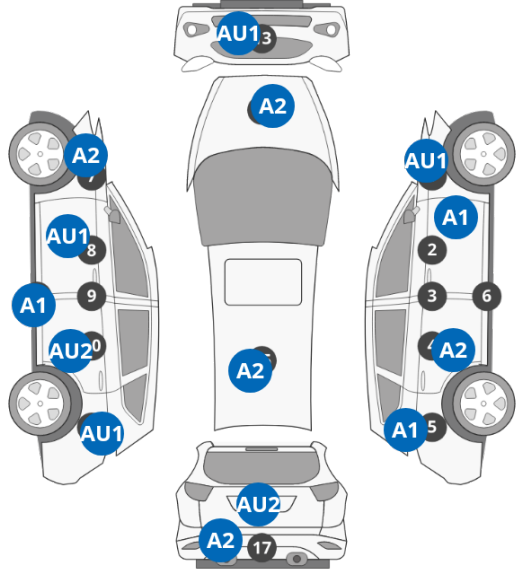
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	130	120	124
2	Boot Lid	113.0	114	115	110
3	Roof	141.2	140	143	141/141
4	Left Front Fender	126.0	123	127	128
5	Left Front Door	149.0	171	133	143
6	Center Panel Left				
7	Left Rear Door	130.3	137	122	132
8	Left Back Panel	124.2	147	82	144
9	Right Front Fender	169.6	157	142	210
10	Right Front Door	134.3	140	133	130
11	Center Panel Right				
12	Right Rear Door	134.6	145	125	134
13	Right Back Panel	142.3	138	133	156

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Crinkle - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate, with warranty and manual booklet, with reverse camera , with spare tire and key, no jack and tools, scratches on taillight and headlight, minor scratches on exterior.