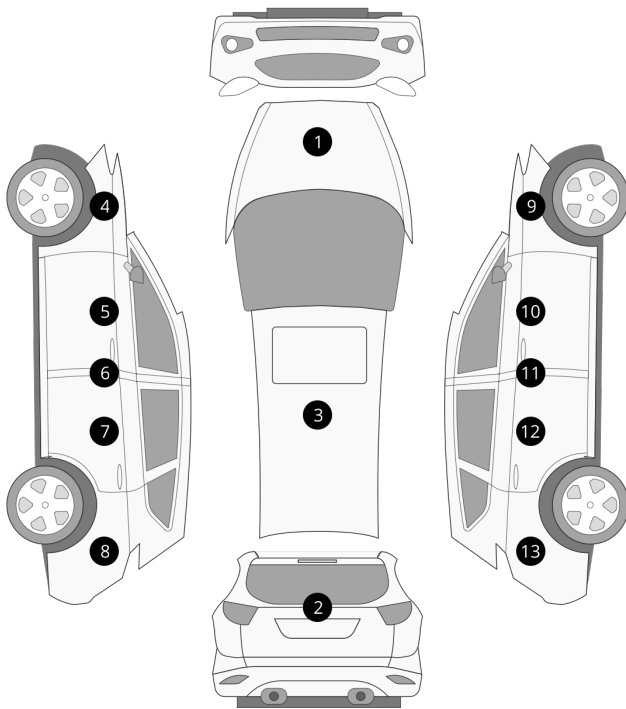


General Information

Date & Time: 29, Apr, 2026 12:06

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	30,053
Registration No.	NIM2973	Chassis No.	PA2JA8EM3P0122213
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



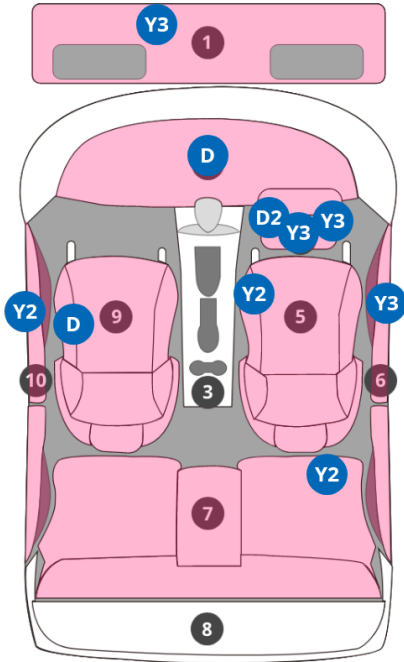
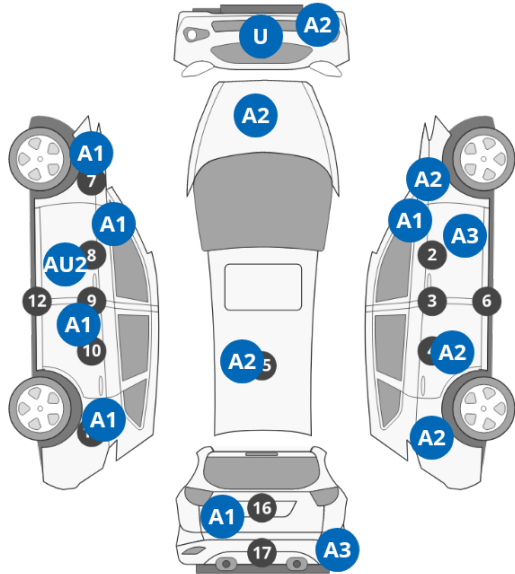
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	170.0	171	169	170
2	Boot Lid	108.6	109	111	106
3	Roof	131.7	113	195	111/108
4	Left Front Fender	170.6	172	167	173
5	Left Front Door	110.3	111	109	111
6	Center Panel Left				
7	Left Rear Door	110.6	114	109	109
8	Left Back Panel	107.6	105	103	115
9	Right Front Fender	198.3	215	176	204
10	Right Front Door	111.0	114	108	111
11	Center Panel Right				
12	Right Rear Door	112.0	116	108	112
13	Right Back Panel	113.3	115	113	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light, power steering issue due to weak battery, airbag indicator ON