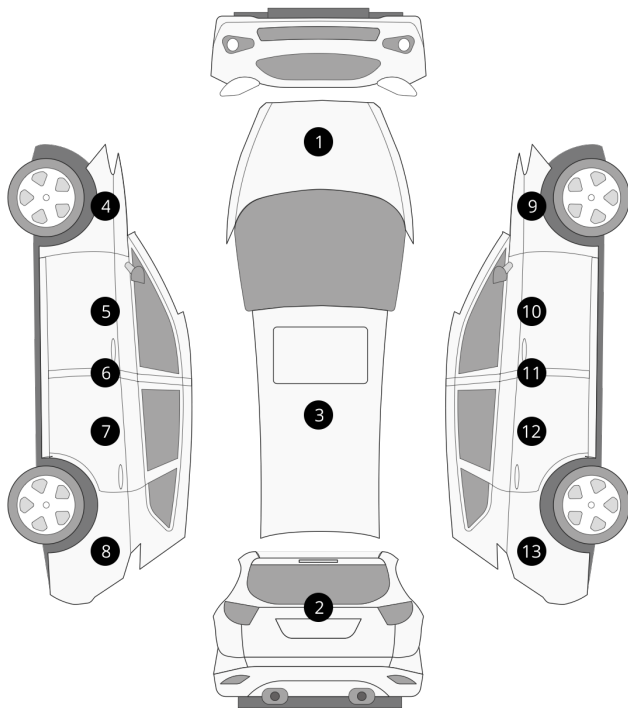


General Information

Date & Time: 18, Feb, 2025 21:03

Make	Toyota	Model	Vios
YOM	2024	Mileage	26,389
Registration No.	NHS1619	Chassis No.	PA1B18F34P4234168
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



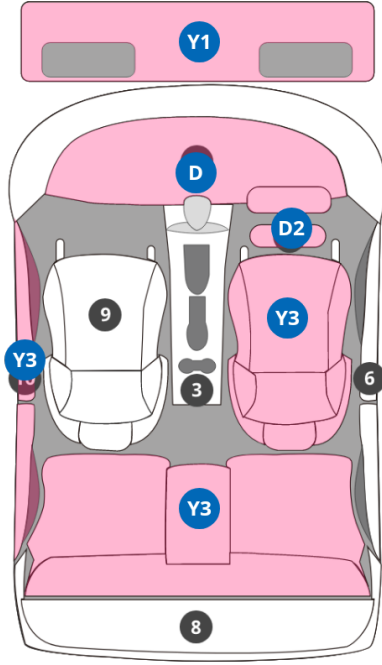
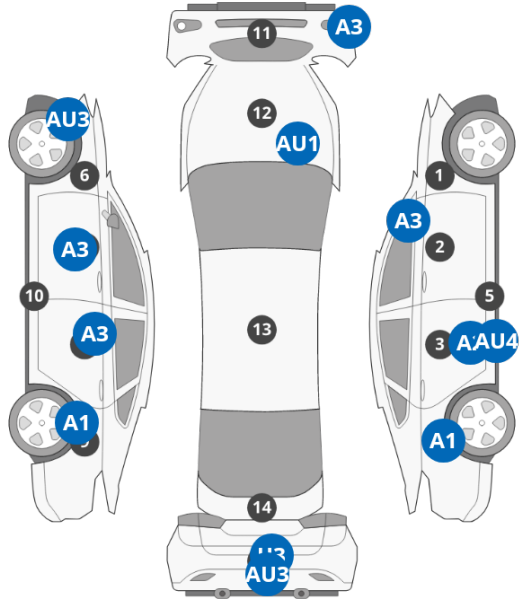
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	112	104	110
2	Boot Lid	102.9	99	104	106
3	Roof	101.4	103	100	99/104
4	Left Front Fender	100.5	96	99	106
5	Left Front Door	97.3	99	100	93
6	Center Panel Left				
7	Left Rear Door	106.0	112	103	103
8	Left Back Panel	102.0	109	100	98
9	Right Front Fender	100.3	97	103	101
10	Right Front Door	94.7	98	93	94
11	Center Panel Right				
12	Right Rear Door	100.3	95	99	107
13	Right Back Panel	100.5	95	101	106

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal	Remarks (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, no LTO plate