

General Information

Date & Time: 21, May, 2026 05:43

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	40,687
Registration No.	NFH2208	Chassis No.	PA1B18F35N4170509
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



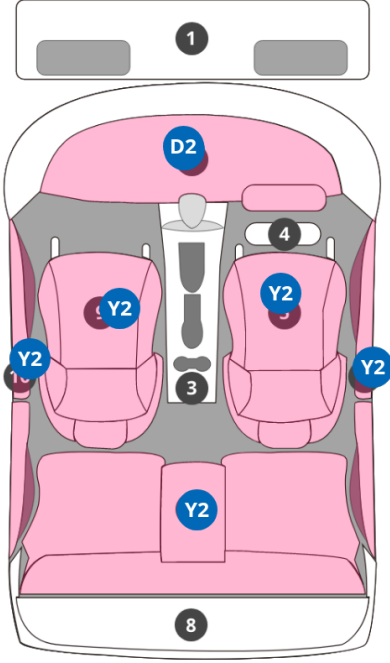
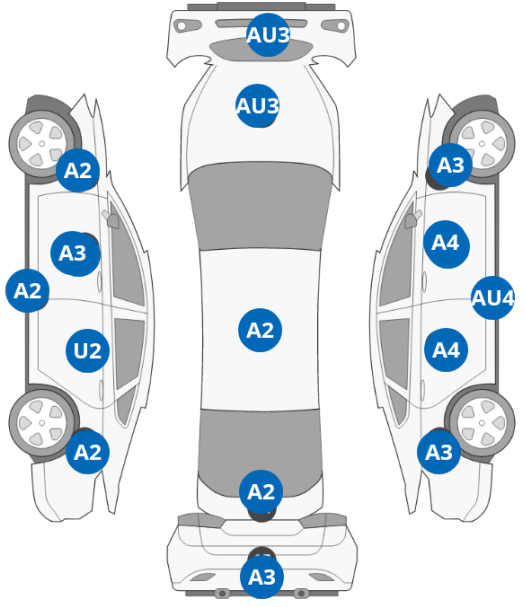
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	113	113	115
2	Boot Lid	115.0	109	116	120
3	Roof	110.7	117	104	101/121
4	Left Front Fender	116.0	115	121	112
5	Left Front Door	106.9	99	110	112
6	Center Panel Left				
7	Left Rear Door	114.0	116	112	114
8	Left Back Panel	112.0	118	108	110
9	Right Front Fender	101.3	102	100	102
10	Right Front Door	113.0	103	110	126
11	Center Panel Right				
12	Right Rear Door	110.8	92	121	120
13	Right Back Panel	109.3	106	104	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Glove Box - Loose, Deformed - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, no warranty booklet, incomplete tools, with jack, with spare tire, no spare key, no seat cover, with hairline scratches, with turbo, with extra muffler, modified to lowered body, horn not functioning, right side room lamp not functioning, steering wheel replaced.