

General Information

Date & Time: 05, May, 2026 15:45

Make	Chevrolet	Model	Trailblazer
YOM	2017	Odo Meter Reading	77,952
Registration No.	NCP9955	Chassis No.	MMM15GEK0HH623546
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



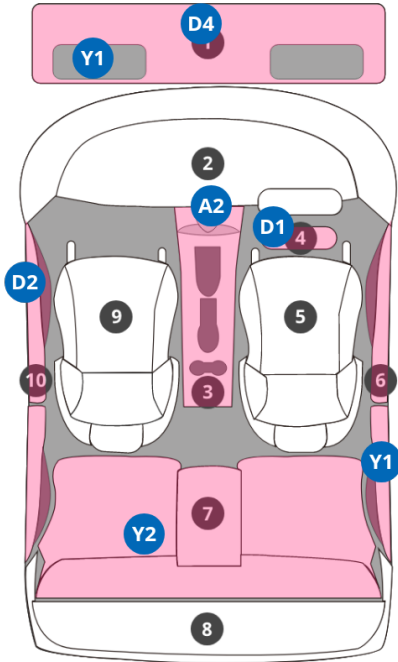
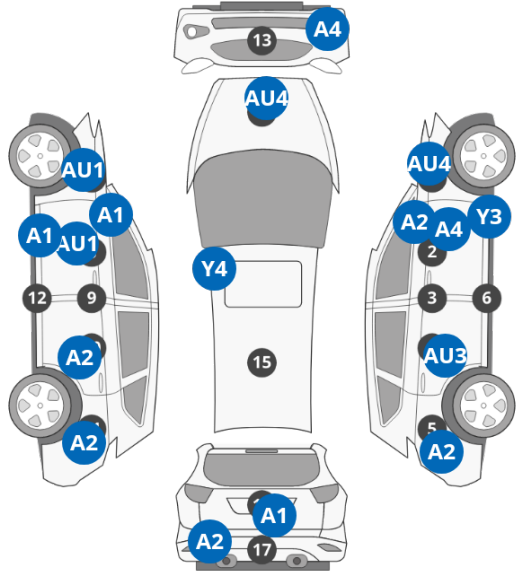
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.3	138	137	137
2	Boot Lid	142.3	143	150	134
3	Roof	136.2	136	129	138/142
4	Left Front Fender	131.3	112	143	139
5	Left Front Door	136.6	138	137	135
6	Center Panel Left				
7	Left Rear Door	138.6	138	140	138
8	Left Back Panel	174.6	185	165	174
9	Right Front Fender	134.3	136	152	115
10	Right Front Door	135.0	137	132	136
11	Center Panel Right				
12	Right Rear Door	136.3	133	135	141
13	Right Back Panel	139.6	137	143	139

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Sunvisor, Sunglass Holder - Grime - Minimal / Knobs - Worn, Peel, Crack - Small / (R) Rear Trim - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Loose, Deformed - Large / (L) Front Trim - Worked - Small / Carpet - Worked - Minimal	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Large / Roof Spoiler, Molding - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
No front Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights